
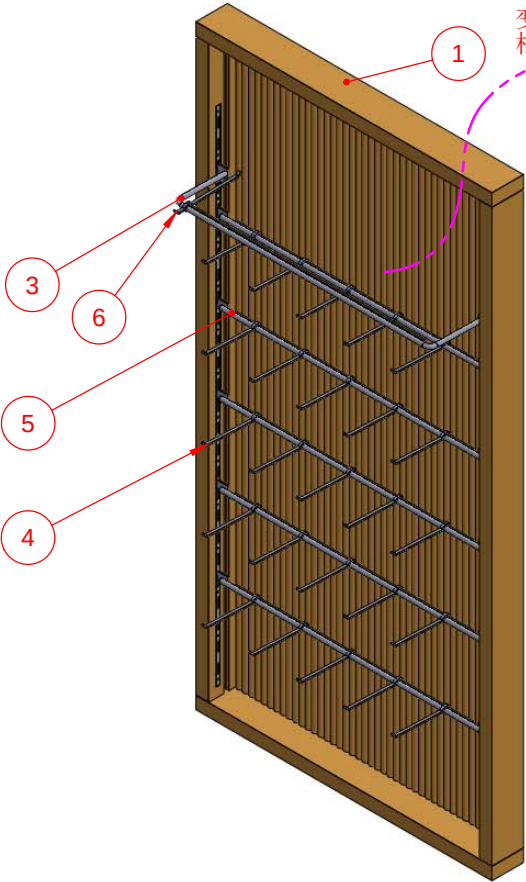


QTY数量	DESCRIBE描述	SUPPLIER供应部门	REFERENCE参考信息	MATERIAL材料	FINISH颜色	PROCESSES工艺	UNIT WEIGHT单件重量(Kg)	TOTAL WEIGHT总重量(Kg)
	8Z40145900	SUPPLIER	REFERENCE			cut/weld/drill/polish/paint	27.00	

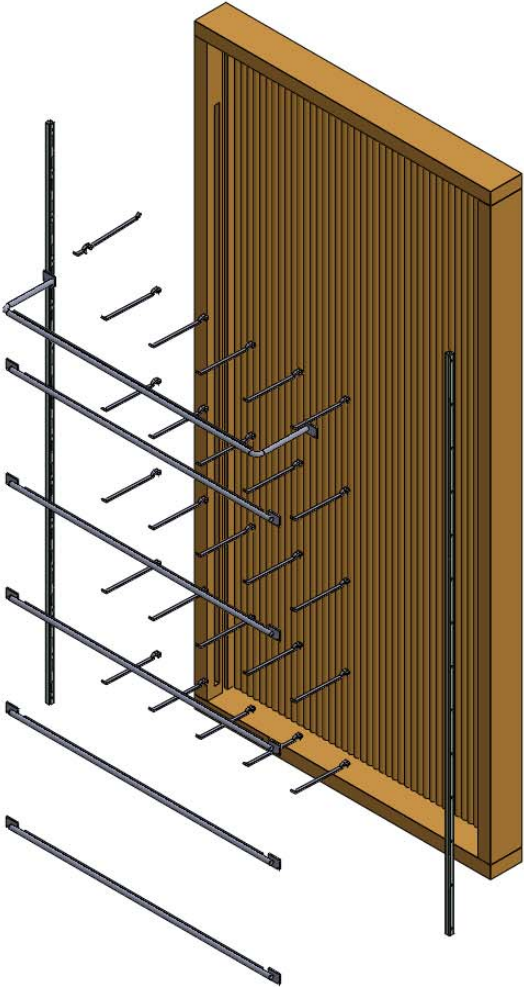

变压器放天花板内，走线从天花走，
柜体顶板可根据现场线位置方向现场开孔

- 技术要求(Technical Requirements):
- 1、供货方要相应同色的连接件;螺栓类连接件要装在相应位置,以防止孔位偏差;
(The supplier needs to provide the connector and match the color.
The threaded rod must be pre-installed into the correct location to avoid the deviation)
 - 2、金属件要求无披锋,焊接牢固,无虚焊,承重部位必须满焊;
(The metal parts must be smoothly, strong welding, full weld on the loading location)
 - 3、金属件所有见光部位不允许有影响外观效果的焊疤;
(Forbid the welding mark on the appearance surface of metal parts)
 - 4、注意公差配合镜子和玻璃尺寸,需与挂臂配合的挂钩内卡口,如未注明公差按负公差0.5mm加工.
(Take note the tolerance for mirror, glass, the hook which needs to assembled with bar and so on, the unspecified tolerance is -0.5mm.)
 - 5、所有可见螺丝均为内六角螺丝;
(All the appearance screws must be allen screws)
 - 6、所有镜子、玻璃、大理石4边和4角都要磨边,金属件所有边角无锋棱\无毛刺,防止伤人.
(All mirrors, glass, marble 4 sides and 4 angles need to sanding, all corners of metal furniture need to polish, no burr, prevent injuries.)
 - 7、凡是涉及到走线的产品,供货方必须穿好电线.
(The supplier must wear all wire.)
 - 8、供货方必须装配好由供货方生产的配套产品,例如层板托、连接件.
(the supplier must Pre assembled accessory, such as lamination, connector.)
 - 9.所有部件焊接时要磨45°左右的斜边,辅助焊接,通过轮廓线外的焊点要磨平.

6	5Z11126006	1	Stainless不锈钢	细拉丝
5	5Z41145902	5	Stainless不锈钢	细拉丝
4	5Z11079803	25	Stainless不锈钢	细拉丝
3	5Z41145906	1	Stainless不锈钢	细拉丝
2	5Z11079805	2	Stainless不锈钢	细拉丝
1	5Z42145901	1	防火MDF	BARROTILLO MADERA CASTAÑO RUSTICADO REF.2019
No. 序号	Part Description 零件描述	数量	MATERIAL	FINISH
SHEET FORMAT 图纸大小	A3	UNITS 单位	mm	8Z40145900
DRAWN BY 制图	hildahong	SCALE 比例	1:12	-总装
ORDER DATE 下单日期	00/00/00	DELIVERY DATE 入库日期	00/00/00	PROJECT NO. 内部单号 0000/00
CLIENT DRAWING 客户图	Proy V.0	VERSION 版本	V.0	STORE CODE 店编号 0000
ASSEMBLED IN 组装场所	INTERIOR	DRAWING TYPE 图纸类型	MANUFACTURING	ORDER NO. 订单号 000
				ZARA
				CAAMAÑOASIA®

