

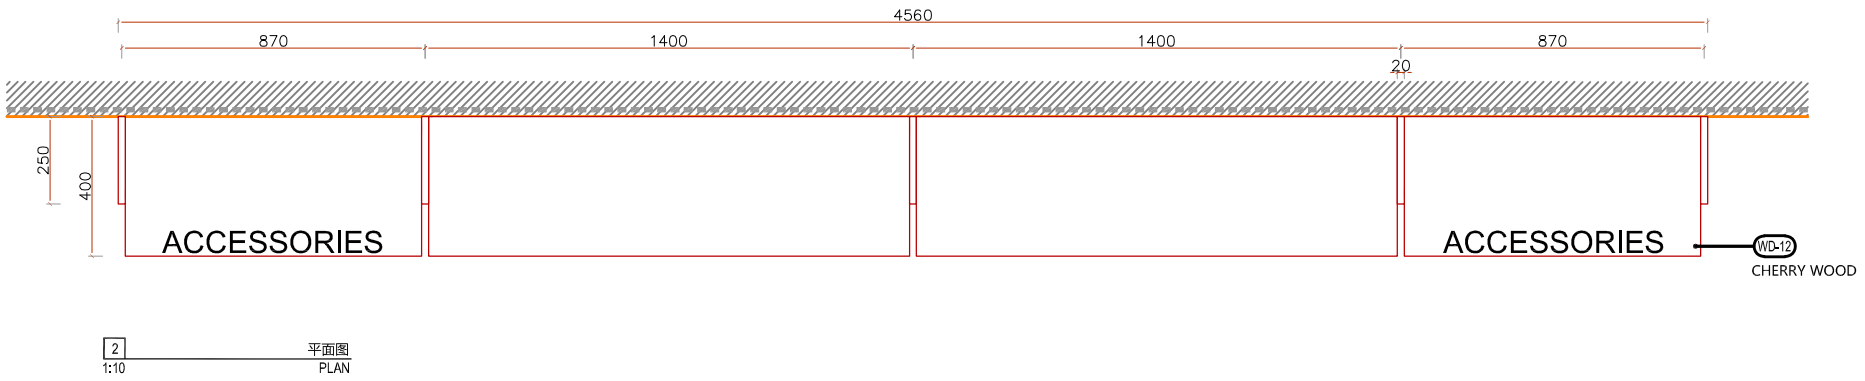
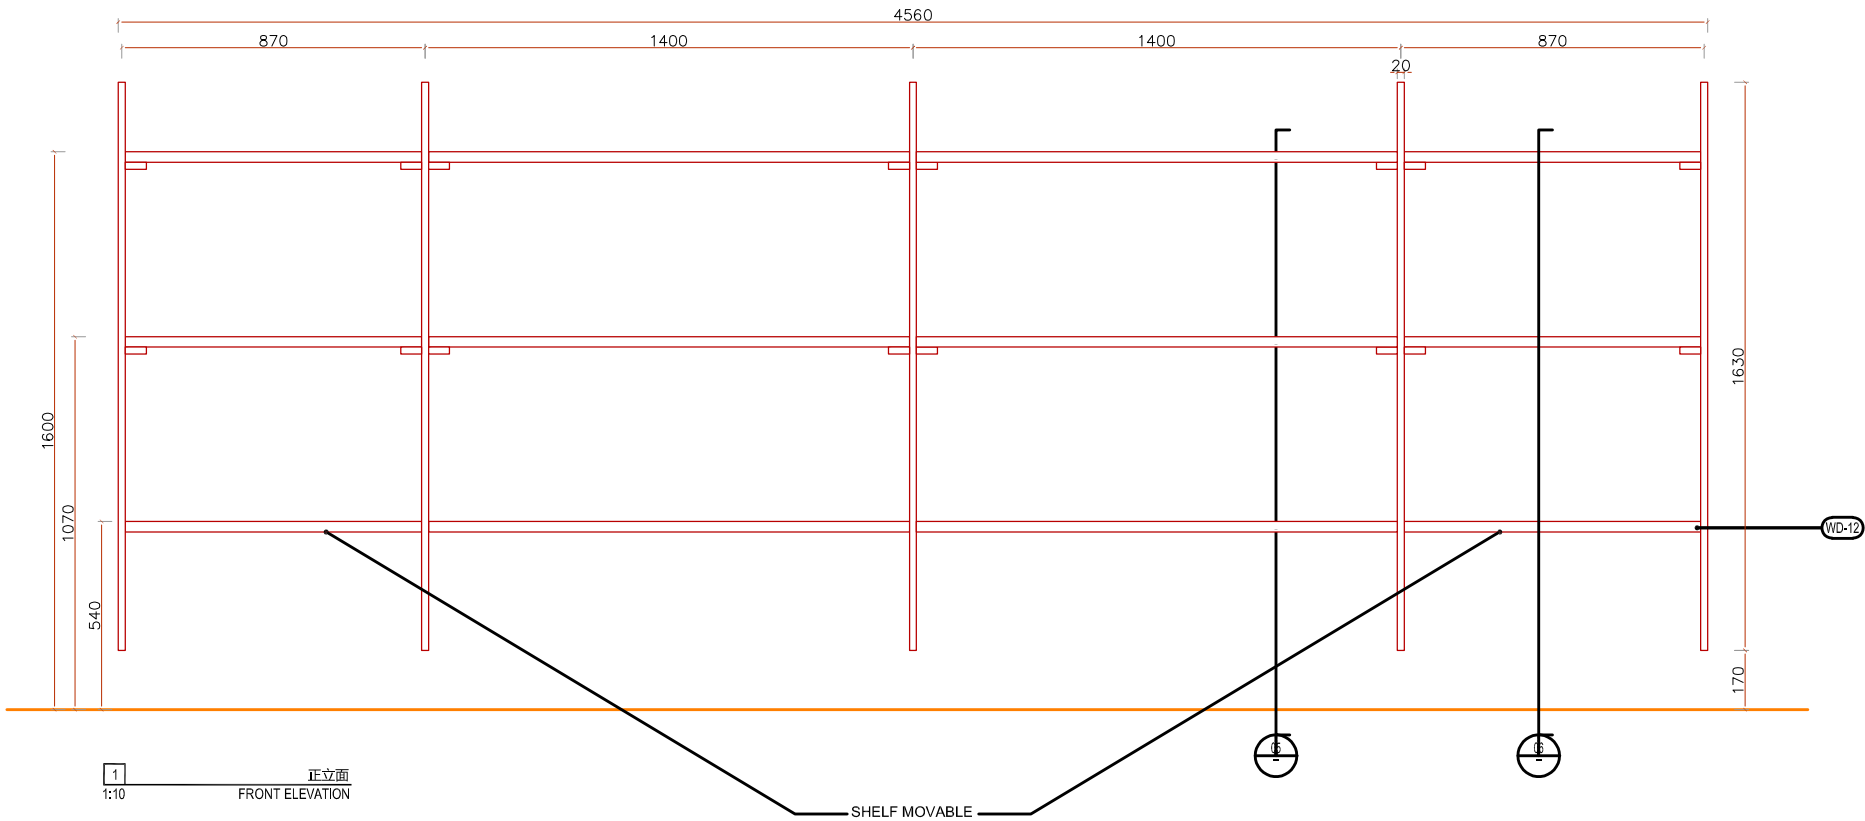
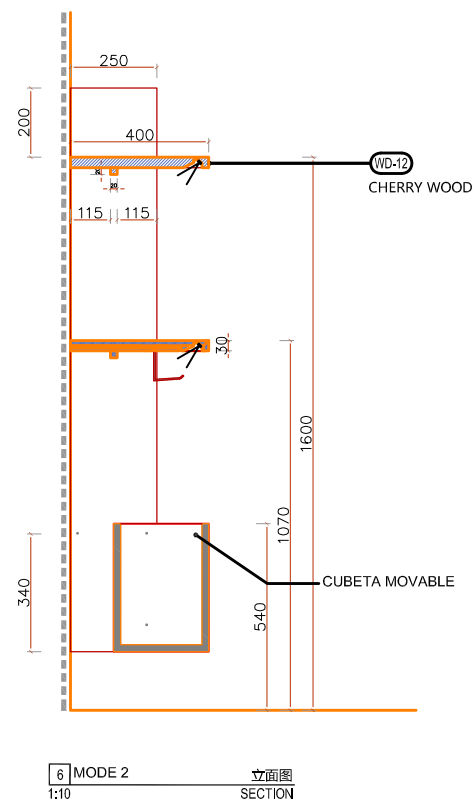


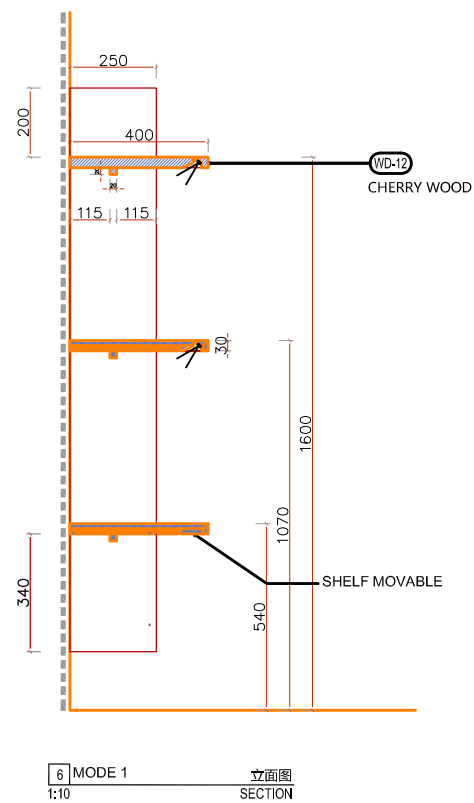


DS-L1-07C		QTY.
L1	L1400XD400 3BALDAS	x2
L1	L850XD400 3BALDAS	x2

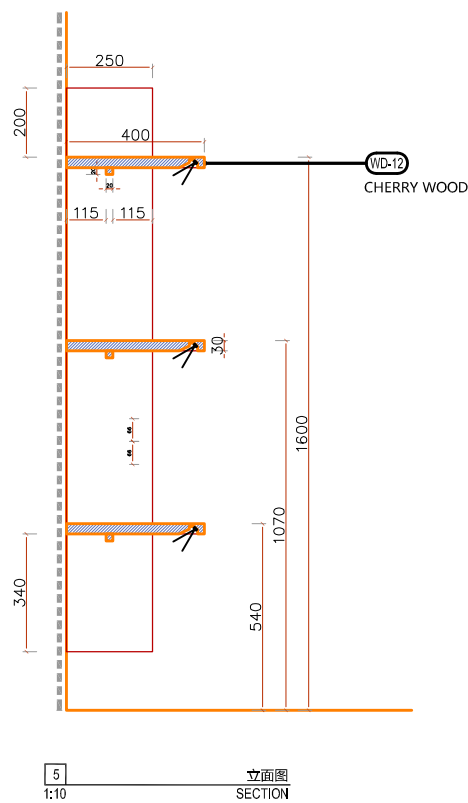


DET. ACCESSORIES SHELVES

DET. CUBETA CINTURONES x2

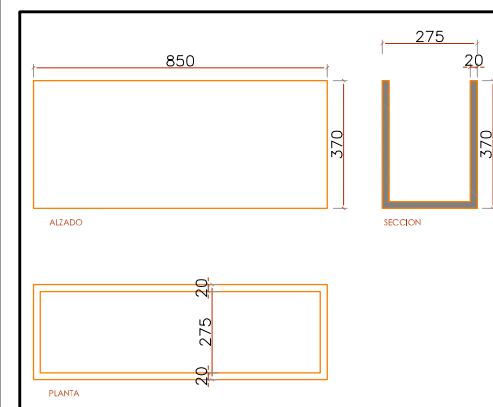


DETALLE BALDA EXTRAIBLE

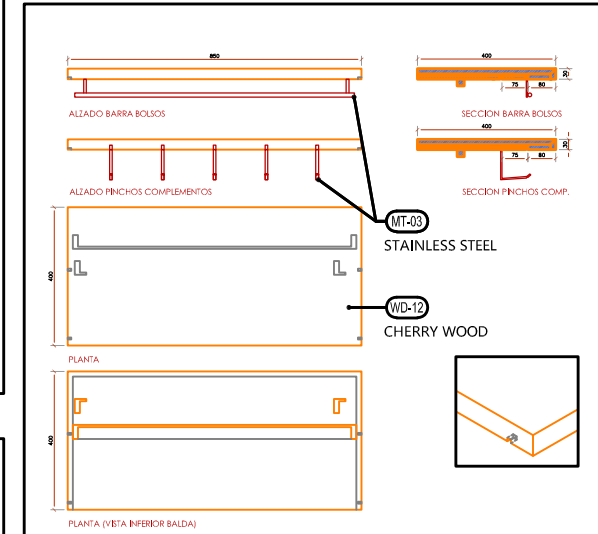

DET. VITRINA





DET. PINCHO

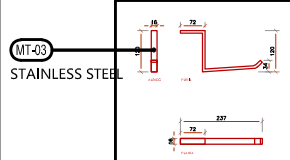


DESCRIPCION	Uds
BALDA EXTRAIBLE	2
BARRA BOLSOS	2
PINCHO CINTURONES	15
VITRINA	1



DESCRIBE描述	ZARA CODE	MATERIAL材料	FINISH颜色	PROCESSES工艺	UNIT WEIGHT单位重量(Kg)
8Z80131000	DS-L1-07C	IRON铁/Stainless不锈钢/防火MDF/Glass玻 璃	防锈底漆/3962-MT-03/3962-WD-12/超白钢化玻璃	cut/weld/drill/polish/paint	382.61

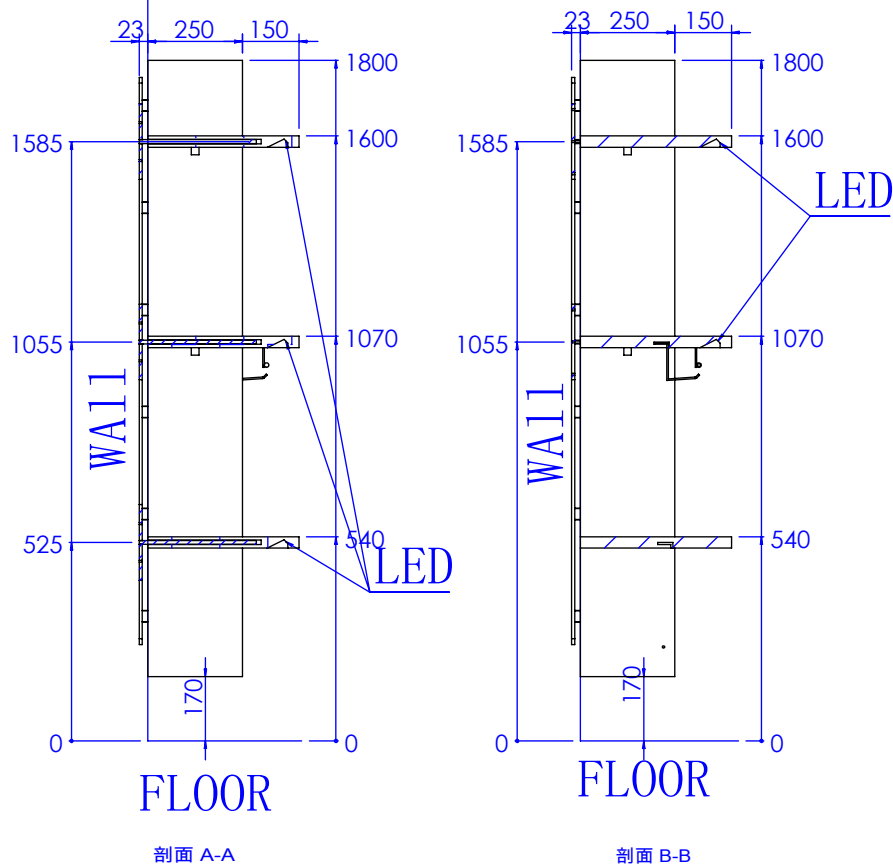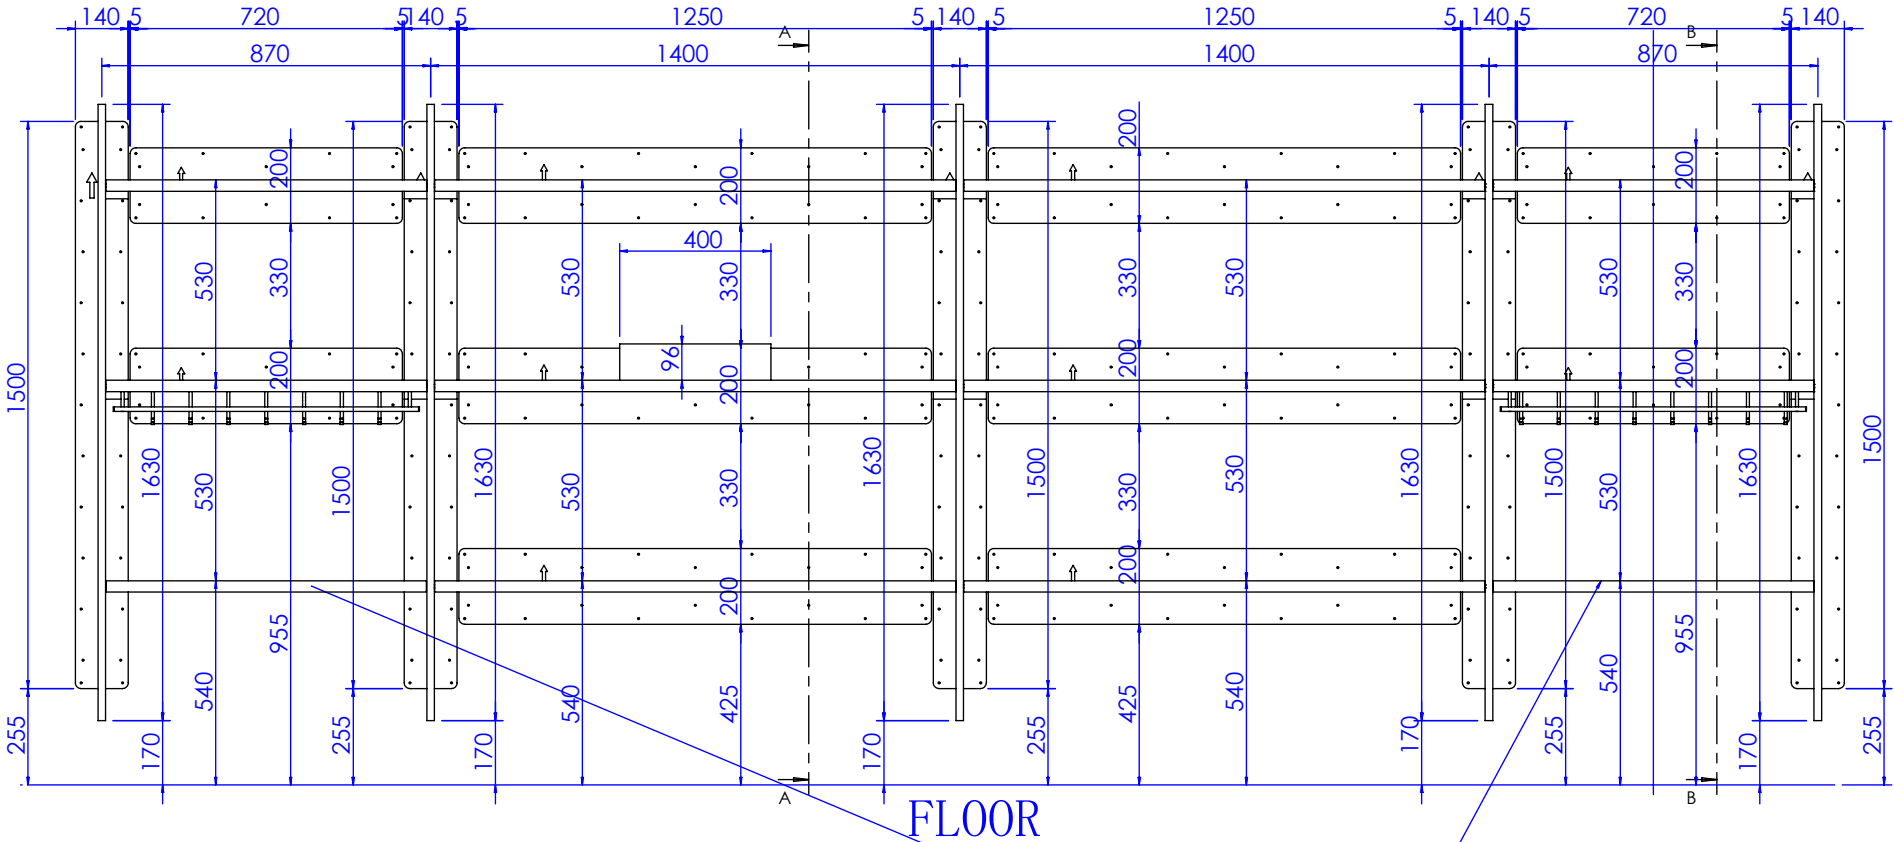

两侧底部层板为活动层板

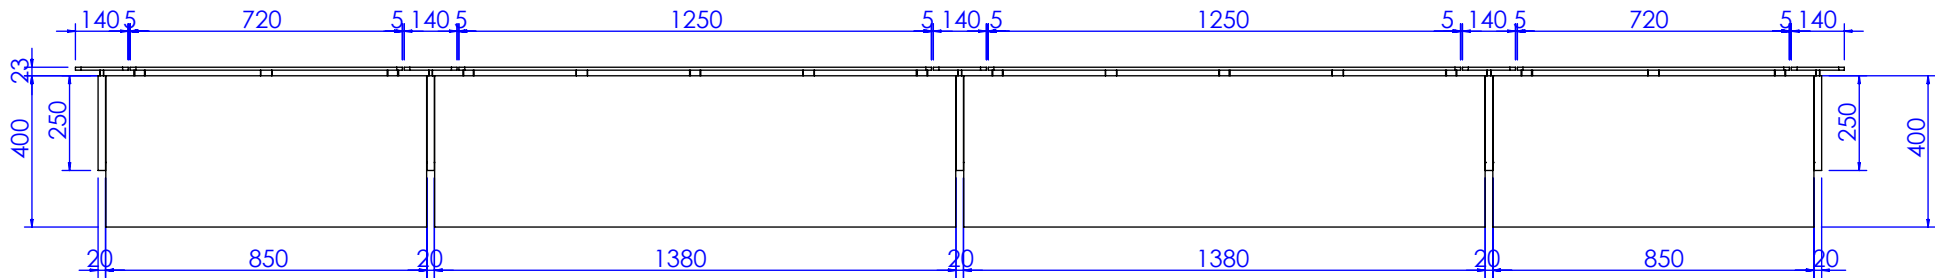

- 技术要求(Technical Requirements):
- 供货方要相应配同色的连接件; 螺杆类连接件要装在相应位置, 以防止孔位偏差;
(The supplier needs to provide the connector and match the color;
The threaded rod must be pre-install into the correct location to avoid the deviation)
 - 金属件要求无焊接, 焊接牢固, 无虚焊, 承重部位必须满焊;
(The metal parts must be smoothly, strong welding, full weld on the loading location)
 - 金属件所有见光部位不允许有影响外观效果的焊疤;
(Forbid the welding mark on the appearance surface of metal parts)
 - 注意公差配合: 镜子和玻璃尺寸, 需与挂臂配合的挂钩内卡口, 如未注明公差按负公差0.5mm加工.
(Take note the tolerance for mirror, glass, the hook which needs to assembled with bar and so on, the unspecified tolerance is -0.5mm.)
 - 所有可见螺丝均为内六角螺丝.
(All the appearance screws must be allen screws)
 - 所有镜子、玻璃、大理石4边和4角都要磨边, 金属件所有边角无坡锋\无毛刺, 防止伤人.
(All mirrors, glass, marble 4 sides and 4 angles need to sanding, all corners of metal furniture need to polish, no burr, prevent injuries.)
 - 凡是涉及到走线的产品, 供货方必须穿好电线.
(The supplier must wear all wire.)
 - 供货方必须装配好由供货方生产的配套产品, 例如层板托、连接件.
(the supplier must Pre assembled accessory, such as lamination, connector.)
 - 所有部件焊接时要磨45°左右的斜边, 辅助焊接, 超过轮廓线外的焊点要磨平。


SHEET FORMAT 图纸大小	A3	UNITS单位	mm	8Z80131000	-层板总装	PROJECT NO.内部单号	STORE CODE店铺号
DRAWN BY制图	FrazerZhu	SCALE比例	1:20			0000/00	0000
ORDER DATE下单日期	00/00/00	DELIVERY DATE入库日期	00/00/00			ORDER NO.订单号	000
CLIENT DRAWING客户图	Proy V.0	VERSION版本	V.0	2 SET L1400XD400 SHELF+2 SET L850XD400 SHELF		ZARA	
ASSEMBLED IN:组装场所	INTERIOR	DRAWING TYPE图纸类型	MANUFACTURING			CAAMAÑOASIA®	

Path存储路径: E:\Frazer Zhu NEW\ZARA 项目\ZARA_3962 OM\8280131000 DS-L1-07C\8280131000


创建日期(Created Date)	上次保存的日期(Last Saved Date)
2026年9月17日 15:42:33	2026年9月17日 18:41:45

共 3 张 第 2 张

DESCRIBE描述	ZARA CODE	MATERIAL材料	FINISH颜色	PROCESSES工艺		UNIT WEIGHT单件重量(Kg)
8Z80131000	DS-L1-07C	IRON铁/Stainless不锈钢/防火MDF/Glass玻璃	防锈底漆/3962-MT-03/3962-WD-12/超白钢化玻璃	cut/weld/drill/polish/paint		382.61

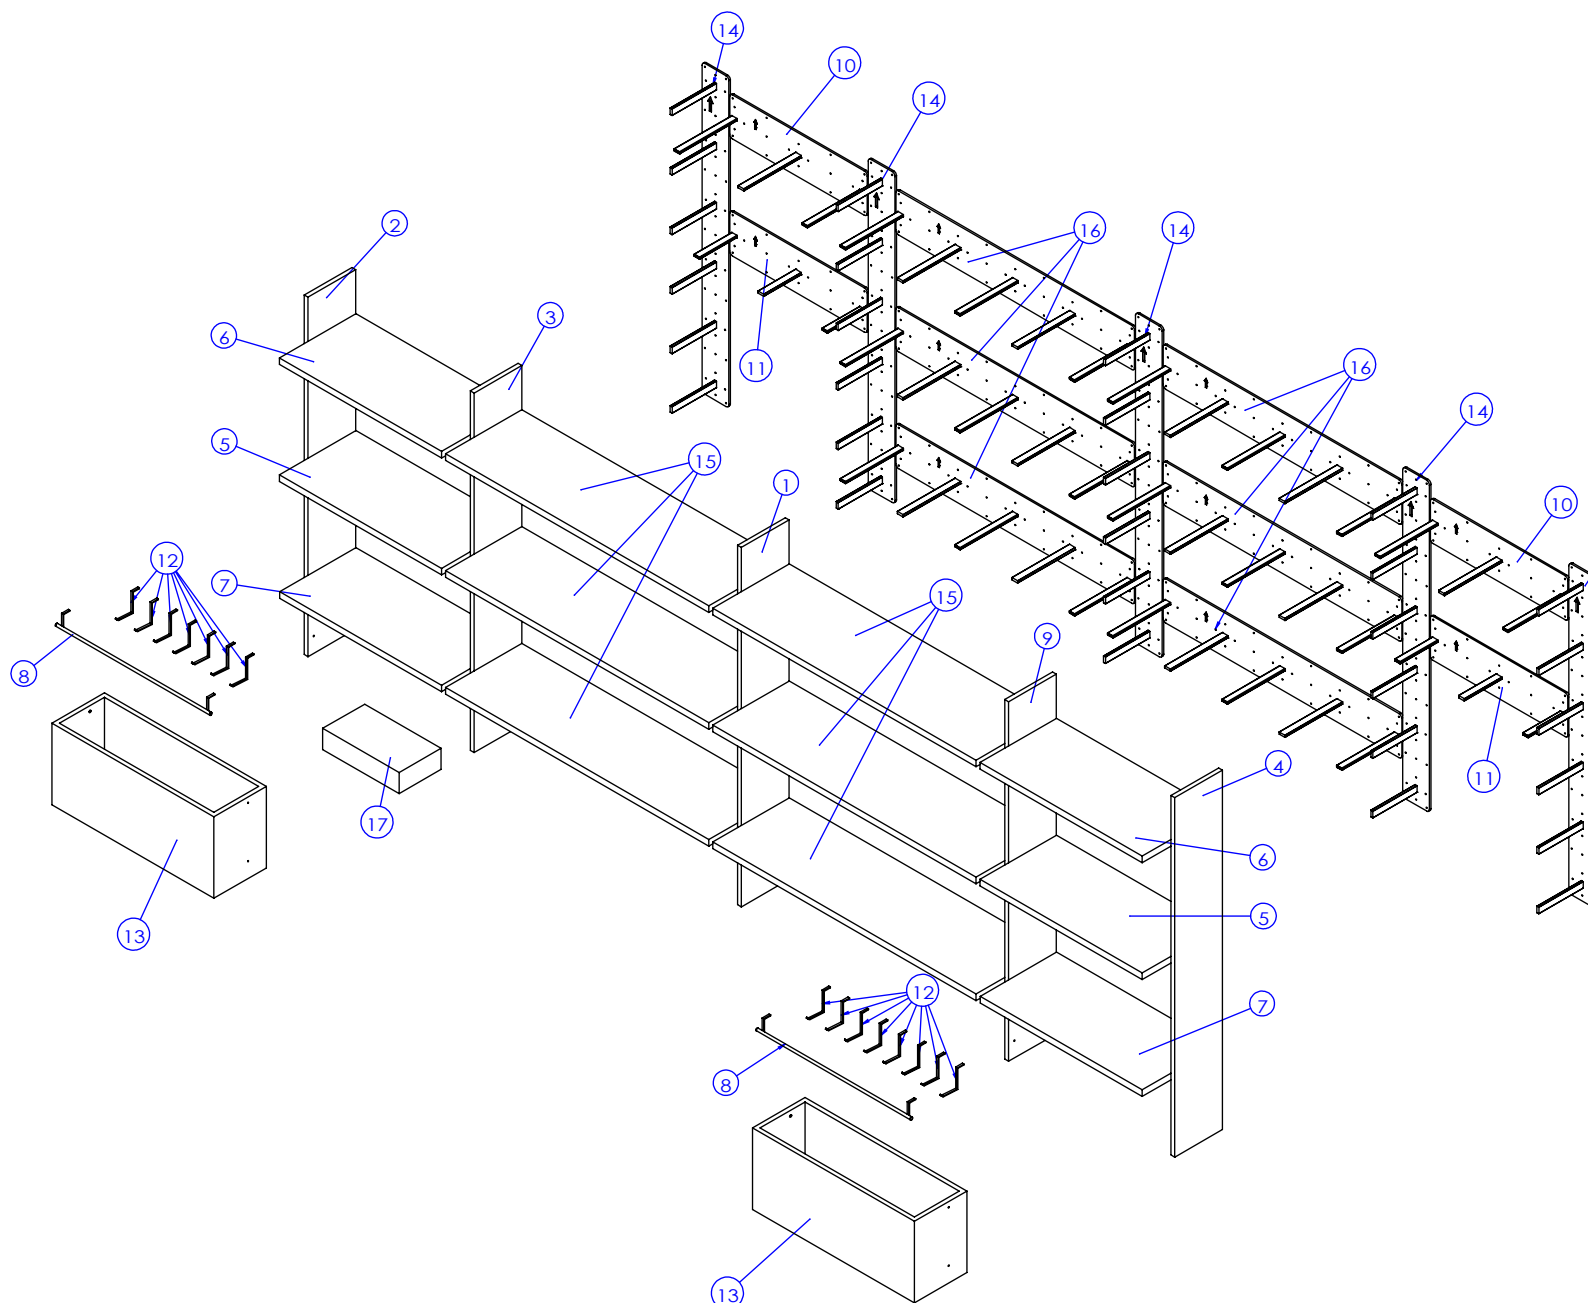

No. 序号	Part Description 零件描述	Quantity 数量	Material 材质	Finish 颜色
1	5Z82131001	1	防火MDF	3962-WD-12
2	5Z82129201	1	防火MDF	3962-WD-12
3	5Z82129202	1	防火MDF	3962-WD-12
4	5Z82129203	1	防火MDF	3962-WD-12
5	5Z82129204	2	防火MDF	3962-WD-12
6	5Z82129205	2	防火MDF	3962-WD-12
7	5Z82129206	2	防火MDF	3962-WD-12
8	5Z81129207	2	Stainless不锈钢	3962-MT-03
9	5Z82129208	1	防火MDF	3962-WD-12
10	5Z81129209	2	IRON铁	防锈底漆
11	5Z81129210	2	IRON铁	防锈底漆
12	5Z81129211	15	Stainless不锈钢	3962-MT-03
13	5Z82129212	2	防火MDF	3962-WD-12
14	5Z81112702	5	IRON铁	防锈底漆
15	5Z82112705	6	防火MDF	3962-WD-12
16	5Z81112706	6	IRON铁	防锈底漆
17	5Z73349706	1	Glass玻璃	超白钢化玻璃

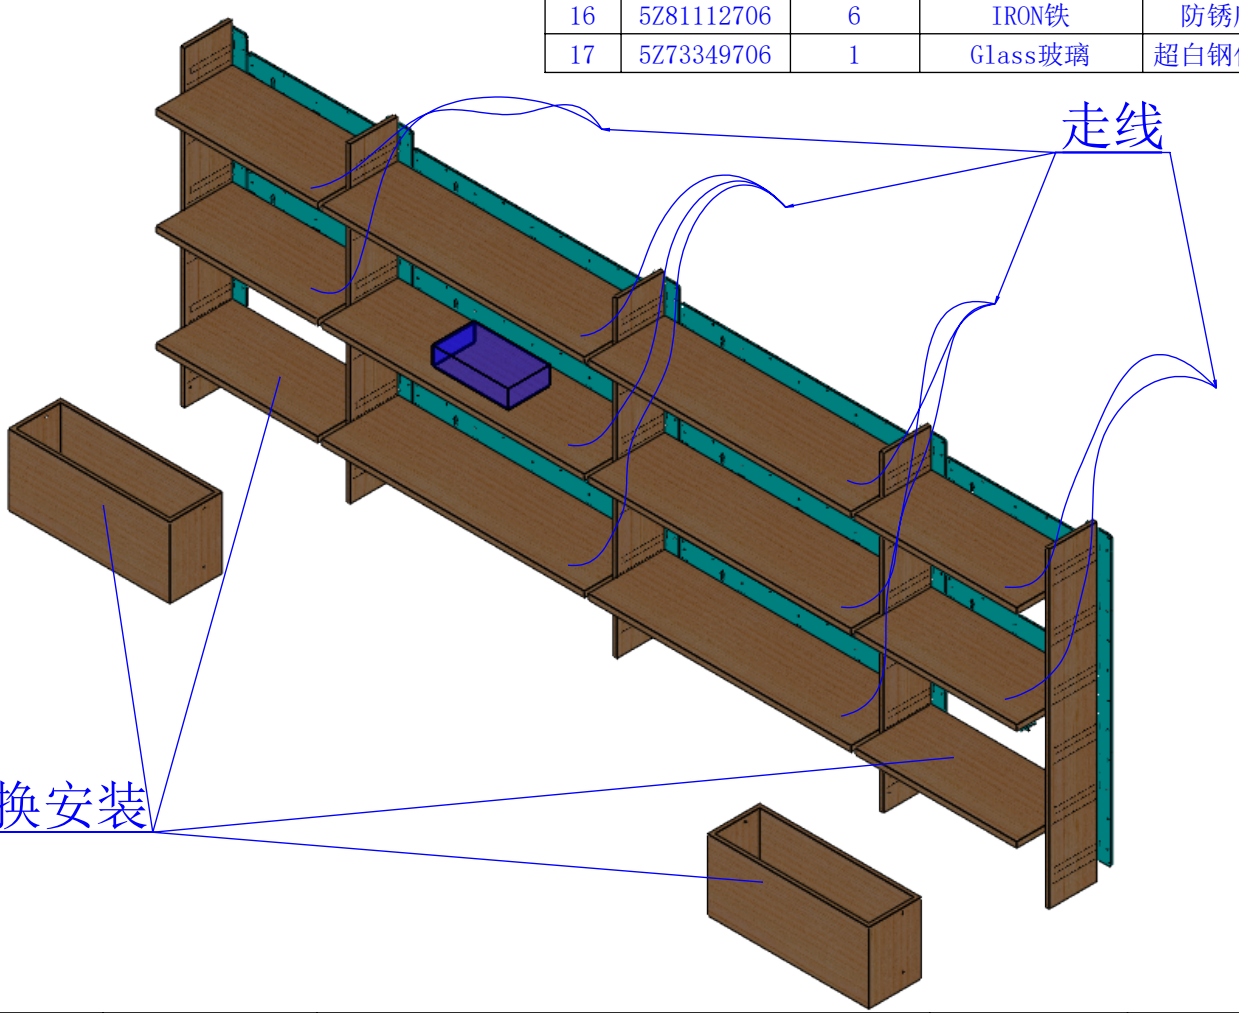

活动可替换安装

Paint Area: 21m²
Paint Color: 3962-WD-12

技术要求(Technical Requirements):

1、供货方要相应配同色的连接件; 螺杆类连接件要装在相应位置, 以防止孔位偏差;
(The supplier needs to provide the connector and match the color;
The threaded rod must be pre-install into the correct location to avoid the deviation)

2、金属件要求无接缝, 焊接牢固, 无虚焊, 承重部位必须满焊;
(The metal parts must be smoothly, strong welding, full weld on the loading location)

3、金属件所有见光部位不允许有影响外观效果的焊疤;
(Forbid the welding mark on the appearance surface of metal parts)

4、注意公差配合: 镜子和玻璃尺寸, 需与挂臂配合的挂钩内卡口, 如未注明公差按负公差0.5mm加工.
(Take note the tolerance for mirror, glass, the hook which needs to assembled with bar and so on, the unspecified tolerance is -0.5mm.)

5、所有可见螺丝均为内六角螺丝.
(All the appearance screws must be allen screws)

6、所有镜子、玻璃、大理石4边和4角都要磨边, 金属件所有边角无坡锋\无毛刺, 防止伤人。
(All mirrors, glass, marble 4 sides and 4 angles need to sanding, all corners of metal furniture need to polish, no burr, prevent injuries.)

7、凡是涉及到走线的产品, 供货方必须穿好电线。
(The supplier must wear all wire.)

8、供货方必须装配好由供货方生产的配套产品, 例如层板托、连接件。
(the supplier must Pre assembled accessory, such as lamination, connector.)

9 所有部件焊接时要磨45°左右的斜边, 辅助焊接, 超过轮廓线外的焊点要磨平。

SHEET FORMAT 图纸大小	A3	UNITS 单位	mm	8Z80131000	-BOM	PROJECT NO. 内部单号	STORE CODE 店铺号
DRAWN BY 制图	FrazerZhu	SCALE 比例	1:28	ORDER DATE 下单日期	00/00/00	DELIVERY DATE 入库日期	00/00/00
CLIENT DRAWING 客户图	Proy V.0	VERSION 版本	V.0	ASSEMBLED IN 组装场所	INTERIOR	DRAWING TYPE 图纸类型	MANUFACTURING

2 SET L1400XD400 SHELF+2 SET L850XD400 SHELF

ZARA

CAAMAÑOASIA 公司