

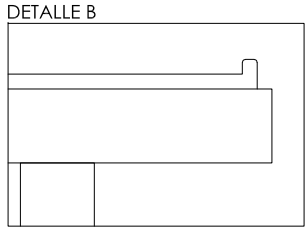
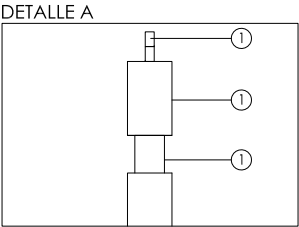
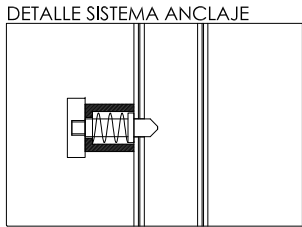
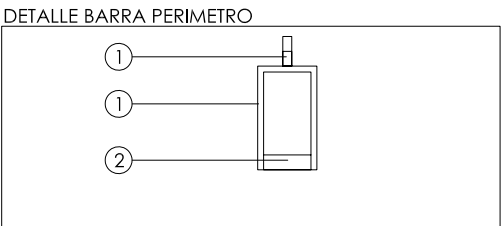
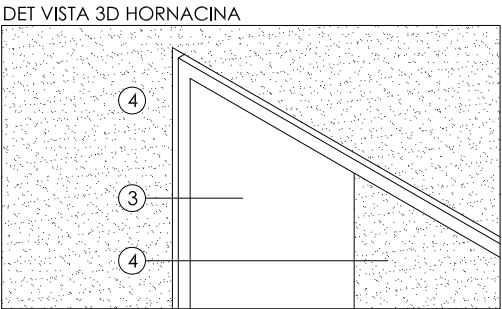
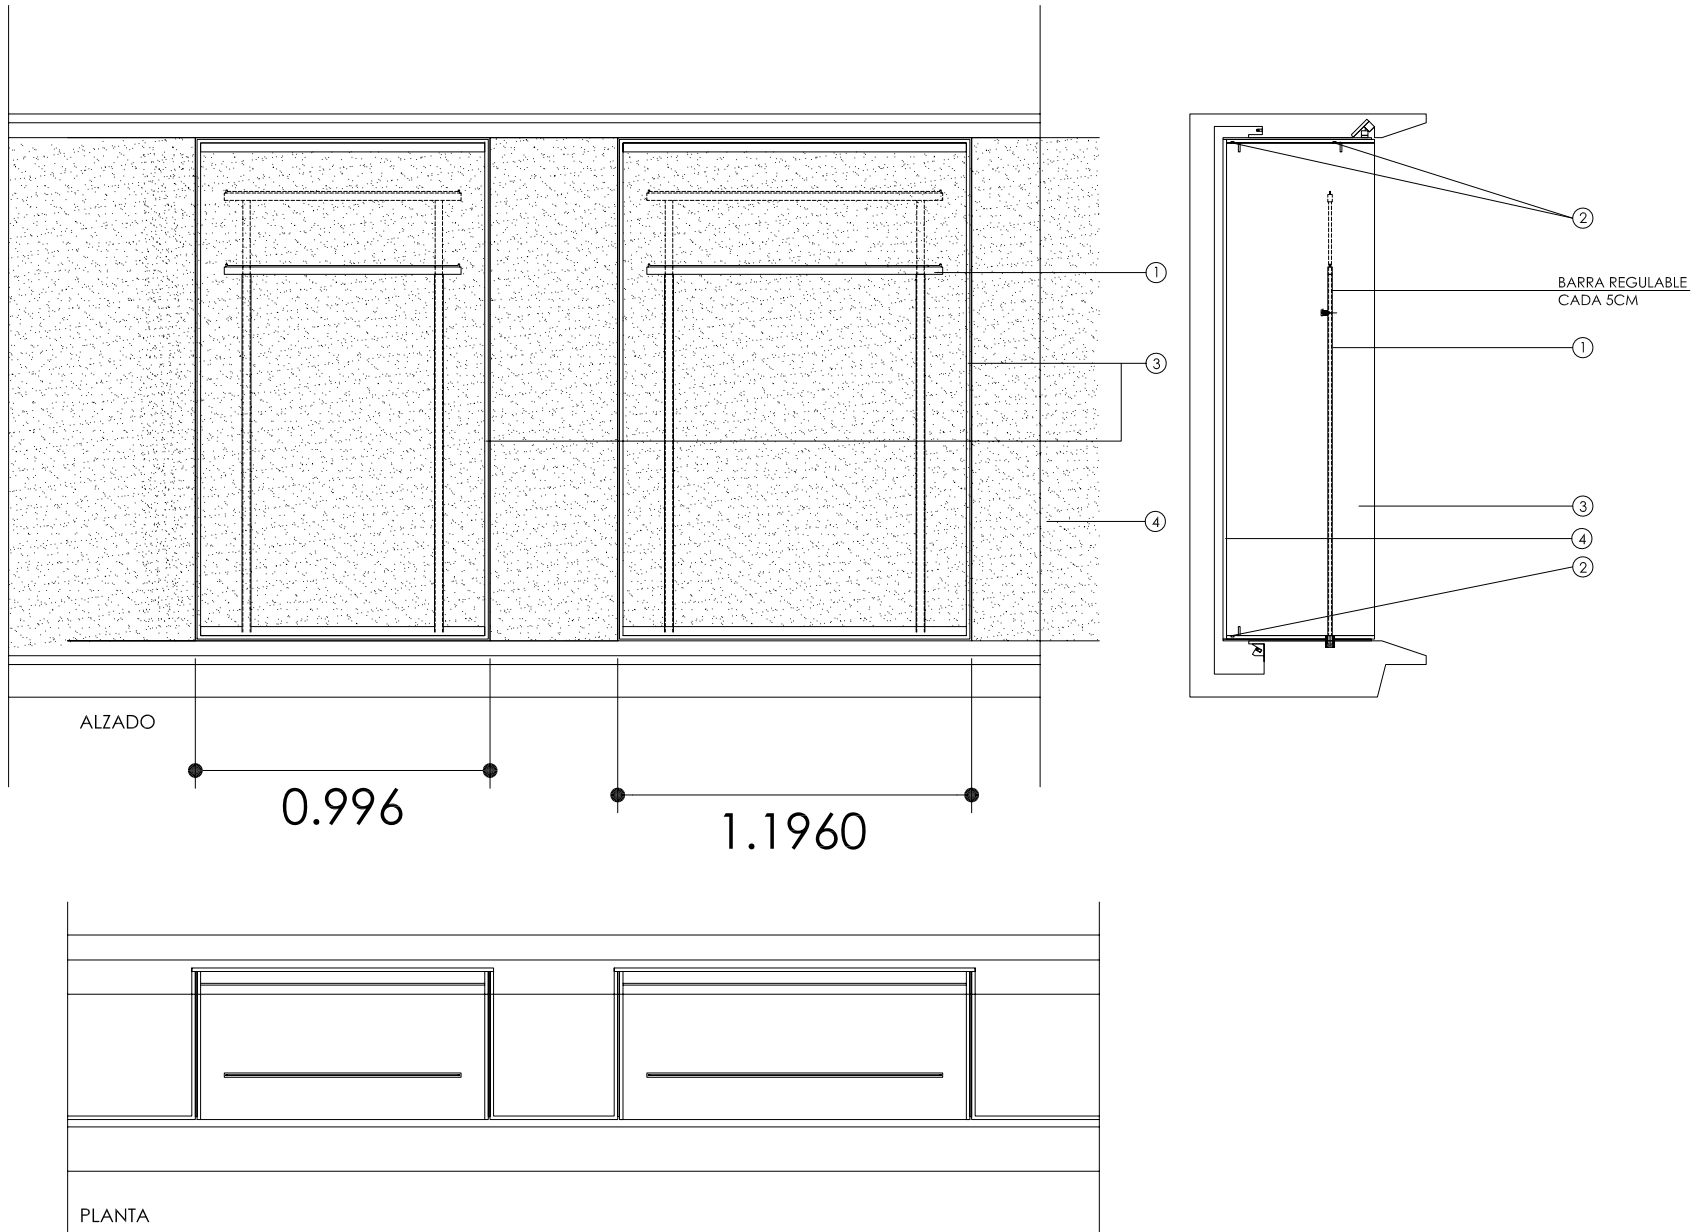
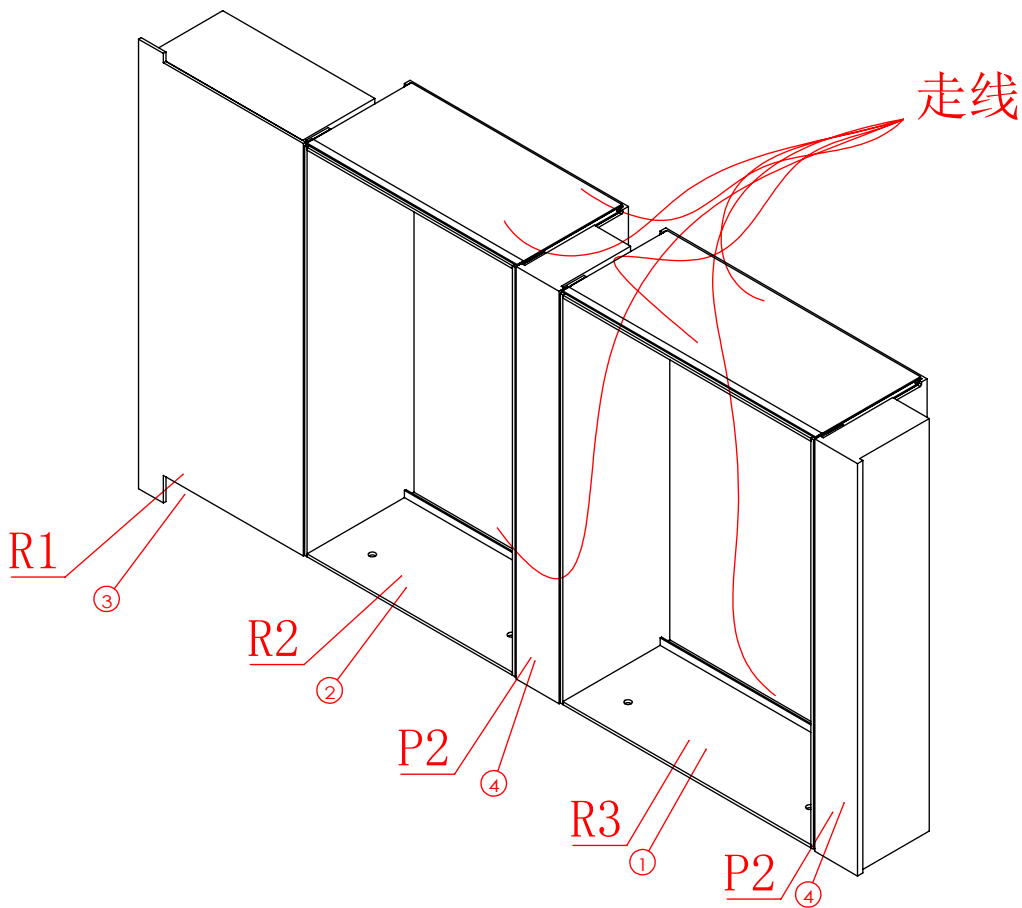
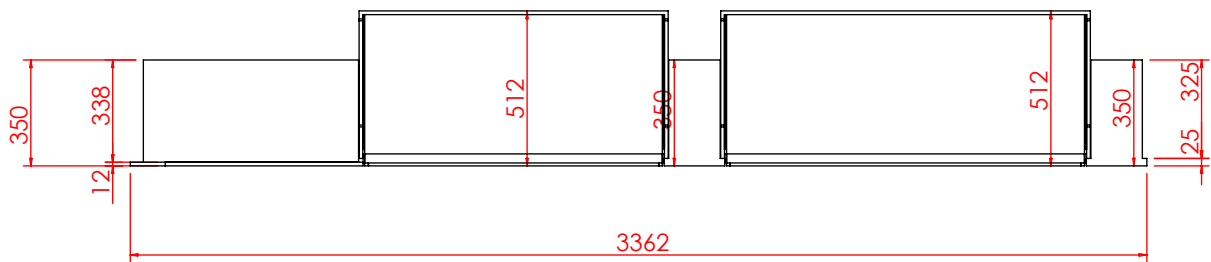


ACABADOS	
①	METAL ACABADO NEGRO ADAPTA RW-9807. REF 2206
②	ILUMINACION LED OPALUX 3100°K
③	KRION 9101 CRYSTAL WHITE ARENADO FINO
④	ACABADO CAJA MARINEDA (DM RAYADO)

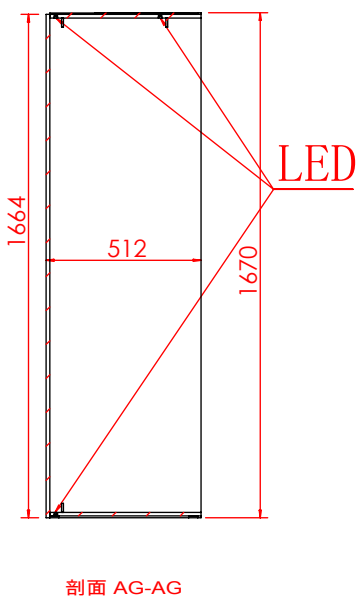

QTY数量	DESCRIBE描述	SUPPLIER供应部门	REFERENCE参考信息	MATERIAL材料	FINISH颜色	PROCESSES工艺	UNIT WEIGHT单件重量(Kg)	TOTAL WEIGHT总重量(Kg)
	8Z70127100-R	SUPPLIER	REFERENCE			cut/weld/drill/polish/paint	288.28	

项目号	零件号	说明	数量
1	5Z75111301		1
2	5Z75111401		1
3	5Z72131204		1
4	5Z72131202		2

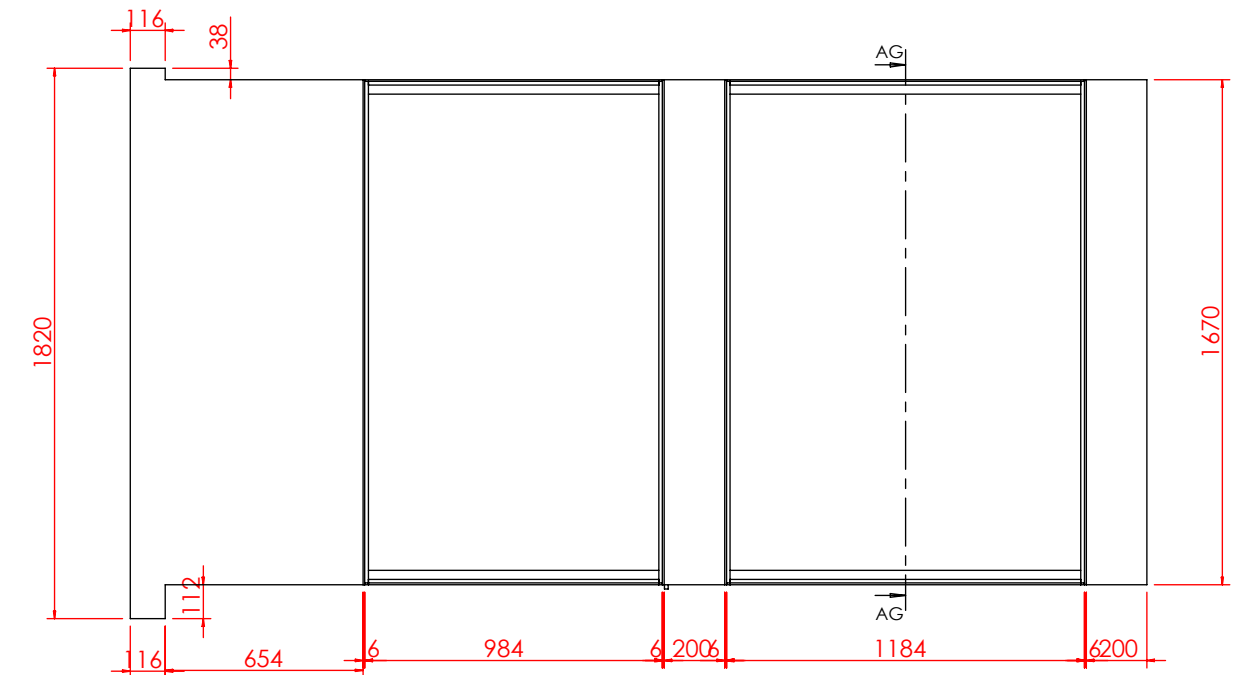



AREA R

- 技术要求(Technical Requirements):
- 供货方要相应配同色的连接件; 螺杆类连接件要装在相应位置, 以防止孔位偏差;
(The supplier needs to provide the connector and match the color;
The threaded rod must be pre-install into the correct location to avoid the deviation)
 - 金属件要求无接棒, 焊接牢固, 无虚焊, 承重部位必须满焊;
(The metal parts must be smoothly, strong welding, full weld on the loading location)
 - 金属件所有见光部位不允许有影响外观效果的焊疤;
(Forbid the welding mark on the appearance surface of metal parts)
 - 注意公差配合: 镜子和玻璃尺寸, 需与挂臂配合的挂钩内卡口, 如未注明公差按负公差0.5mm加工.
(Take note the tolerance for mirror, glass, the hook which needs to assembled with bar and so on, the unspecified tolerance is -0.5mm.)
 - 所有可见螺丝均为内六角螺丝.
(All the appearance screws must be allen screws)
 - 所有镜子、玻璃、大理石4边和4角都要磨边, 金属件所有边角无坡锋\无毛刺, 防止伤人。
(All mirrors, glass, marble 4 sides and 4 angles need to sanding, all corners of metal furniture need to polish, no burr, prevent injuries.)
 - 凡是涉及到走线的产品, 供货方必须穿好电线。
(The supplier must wear all wire.)
 - 供货方必须装配好由供货方生产的配套产品, 例如层板托、连接件。
(the supplier must Pre assembled accessory, such as lamination, connector.)
 - 所有部件焊接时要磨45°左右的斜边, 辅助焊接, 超过轮廓线外的焊点要磨平。



SHEET FORMAT 图纸大小	A3	UNITS单位	mm	8Z70127100-R	-总装	PROJECT NO.内部单号	STORE CODE店铺号
DRAWN BY制图	FrazerZhu	SCALE比例	1:25			0000/00	0000
ORDER DATE下单日期	00/00/00	DELIVERY DATE入库日期	00/00/00			ORDER NO.订单号	000
CLIENT DRAWING客户图	Proy V.0	VERSION版本	V.0			ZARA	
ASSEMBLED IN:组装场所	INTERIOR	DRAWING TYPE图纸类型	MANUFACTURING			CAAMAÑOASIA®	

QTY数量	DESCRIBE描述	SUPPLIER供应部门	REFERENCE参考信息	MATERIAL材料	FINISH颜色	PROCESSES工艺	UNIT WEIGHT单件重量(Kg)	TOTAL WEIGHT总重量(Kg)
	8Z70127100-T	SUPPLIER	REFERENCE			cut/weld/drill/polish/paint	288.26	

项目号	零件号	说明	数量
1	5Z75111301		1
2	5Z75111401		1
3	5Z72131202		2
4	5Z72131206		1

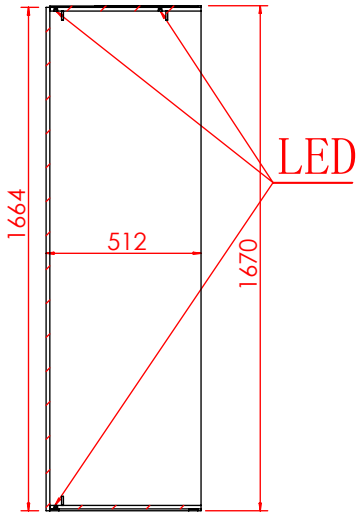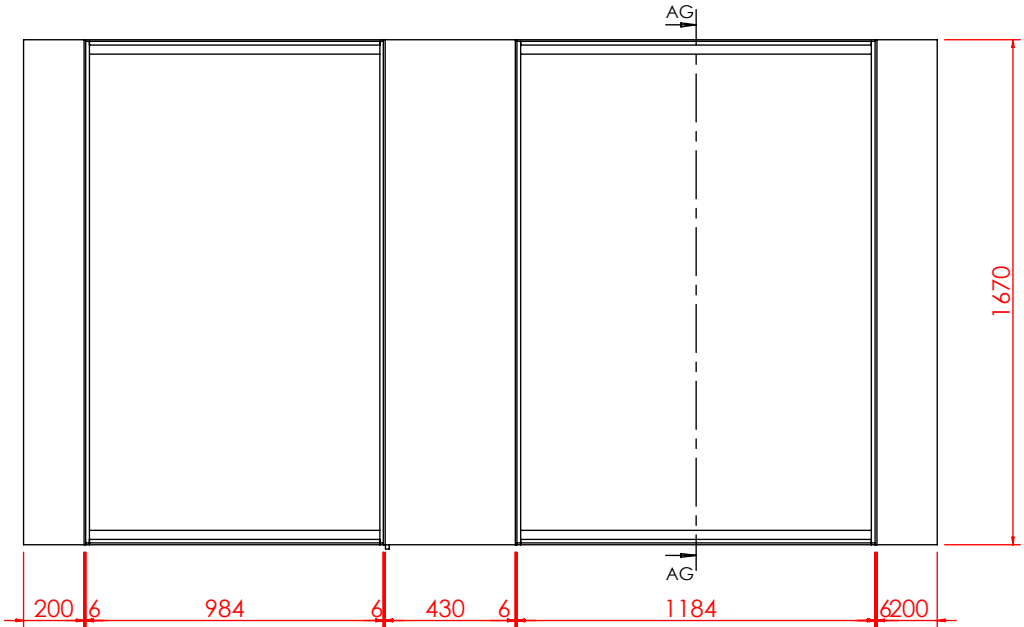

剖面 AG-AG

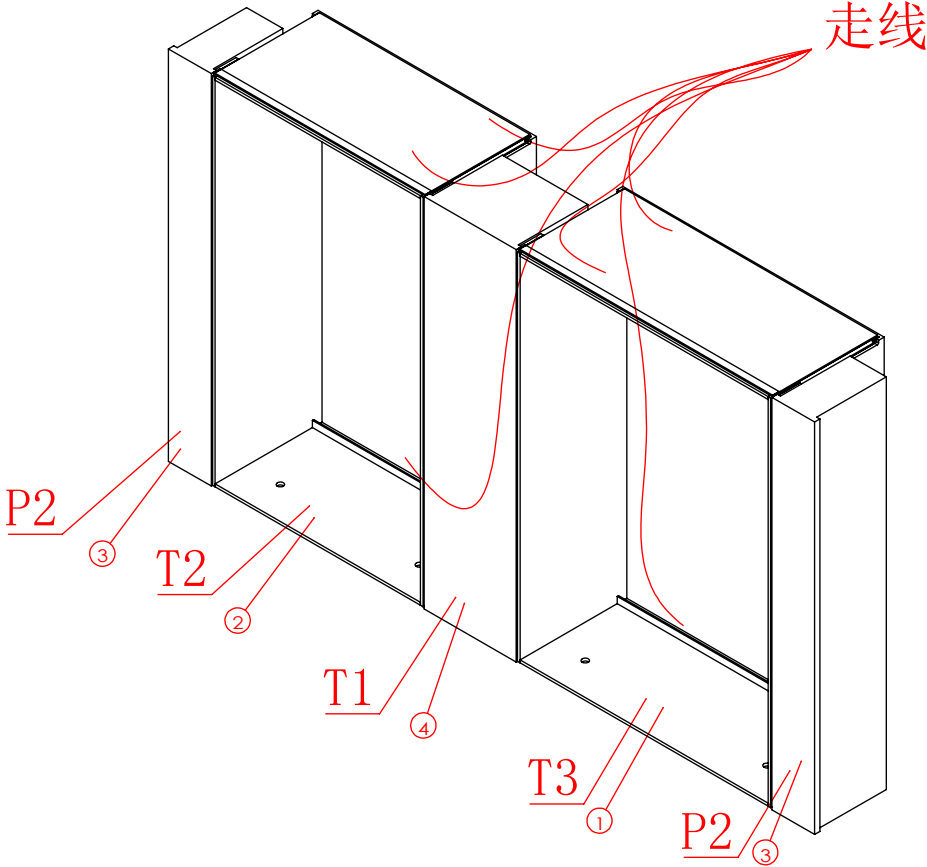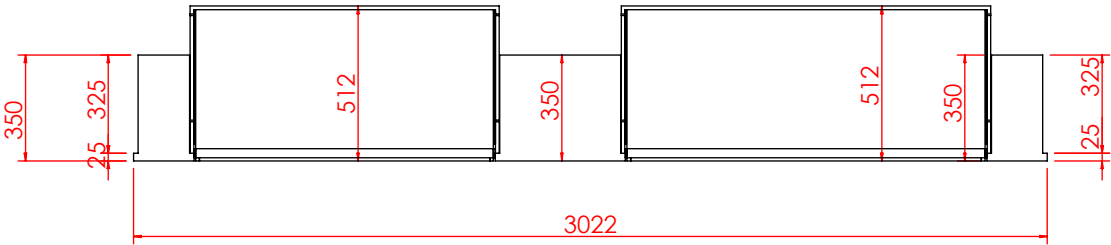



AREA T

- 技术要求(Technical Requirements):
- 供货方要相应配同色的连接件; 螺杆类连接件要装在相应位置, 以防止孔位偏差;
(The supplier needs to provide the connector and match the color;
The threaded rod must be pre-install into the correct location to avoid the deviation)
 - 金属件要求无接缝, 焊接牢固, 无虚焊, 承重部位必须满焊;
(The metal parts must be smoothly, strong welding, full weld on the loading location)
 - 金属件所有见光部位不允许有影响外观效果的焊疤;
(Forbid the welding mark on the appearance surface of metal parts)
 - 注意公差配合: 镜子和玻璃尺寸, 需与挂臂配合的挂钩内卡口, 如未注明公差按负公差0.5mm加工.
(Take note the tolerance for mirror, glass, the hook which needs to assembled with bar and so on, the unspecified tolerance is -0.5mm.)
 - 所有可见螺丝均为内六角螺丝.
(All the appearance screws must be allen screws)
 - 所有镜子、玻璃、大理石4边和4角都要磨边, 金属件所有边角无坡锋\无毛刺, 防止伤人。
(All mirrors, glass, marble 4 sides and 4 angles need to sanding, all corners of metal furniture need to polish, no burr, prevent injuries.)
 - 凡是涉及到走线的产品, 供货方必须穿好电线。
(The supplier must wear all wire.)
 - 供货方必须装配好由供货方生产的配套产品, 例如层板托、连接件。
(the supplier must Pre assembled accessory, such as lamination, connector.)
 - 所有部件焊接时要磨45°左右的斜边, 辅助焊接, 超过轮廓线外的焊点要磨平。



SHEET FORMAT 图纸大小	A3	UNITS单位	mm	8Z70127100-T	-总装	PROJECT NO.内部单号	STORE CODE店铺号
DRAWN BY制图	FrazerZhu	SCALE比例	1:25			0000/00	0000
ORDER DATE下单日期	00/00/00	DELIVERY DATE入库日期	00/00/00			ORDER NO.订单号	000
CLIENT DRAWING图户图	Proy V.0	VERSION版本	V.0			ZARA	
ASSEMBLED IN:组装场所	INTERIOR	DRAWING TYPE图纸类型	MANUFACTURING			CAAMAÑOASIA®	

QTY数量	DESCRIBE描述	SUPPLIER供应部门	REFERENCE参考信息	MATERIAL材料	FINISH颜色	PROCESSES工艺	UNIT WEIGHT单件重量(Kg)	TOTAL WEIGHT总重量(Kg)
	8Z70127100-X	SUPPLIER	REFERENCE			cut/weld/drill/polish/paint	288.28	

项目号	零件号	说明	数量
1	5Z75111301		1
2	5Z75111401		1
3	5Z72131204		1
4	5Z72131202		2

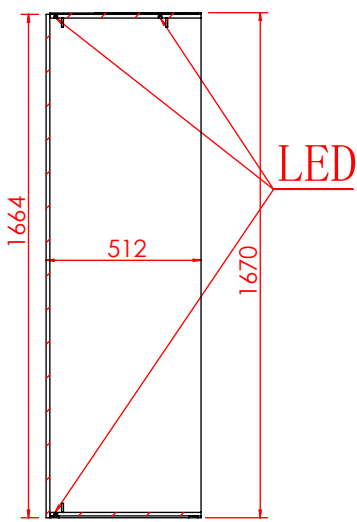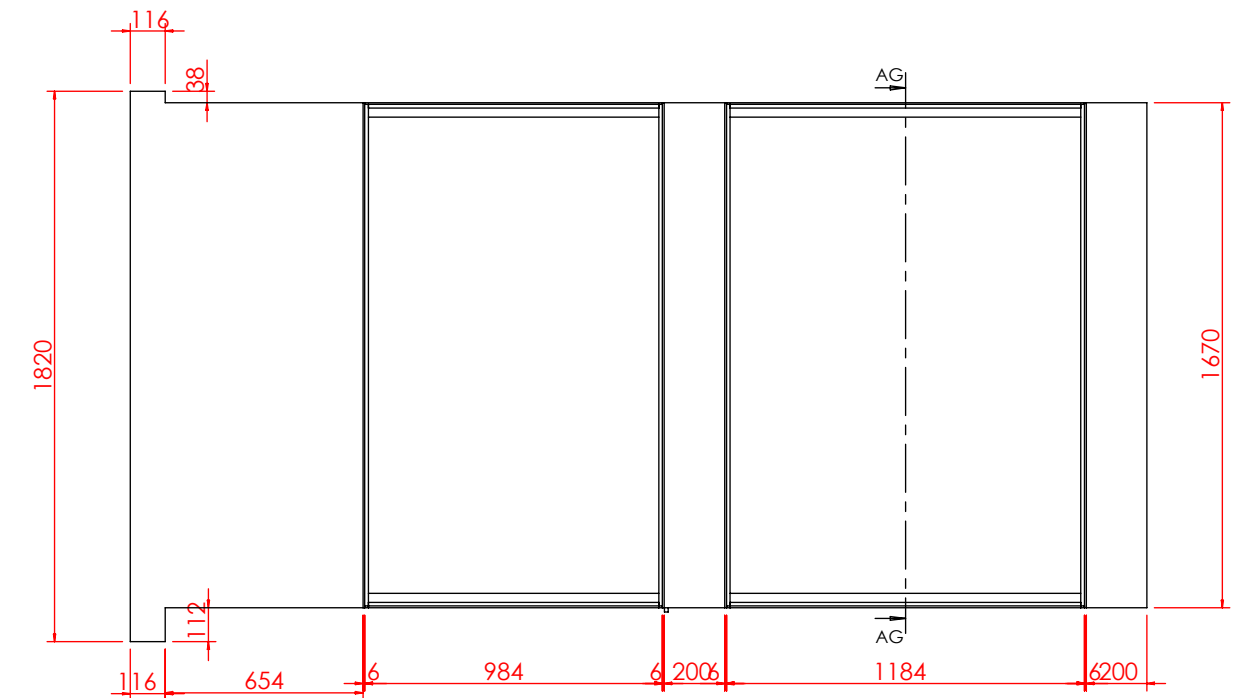

剖面 AG-AG

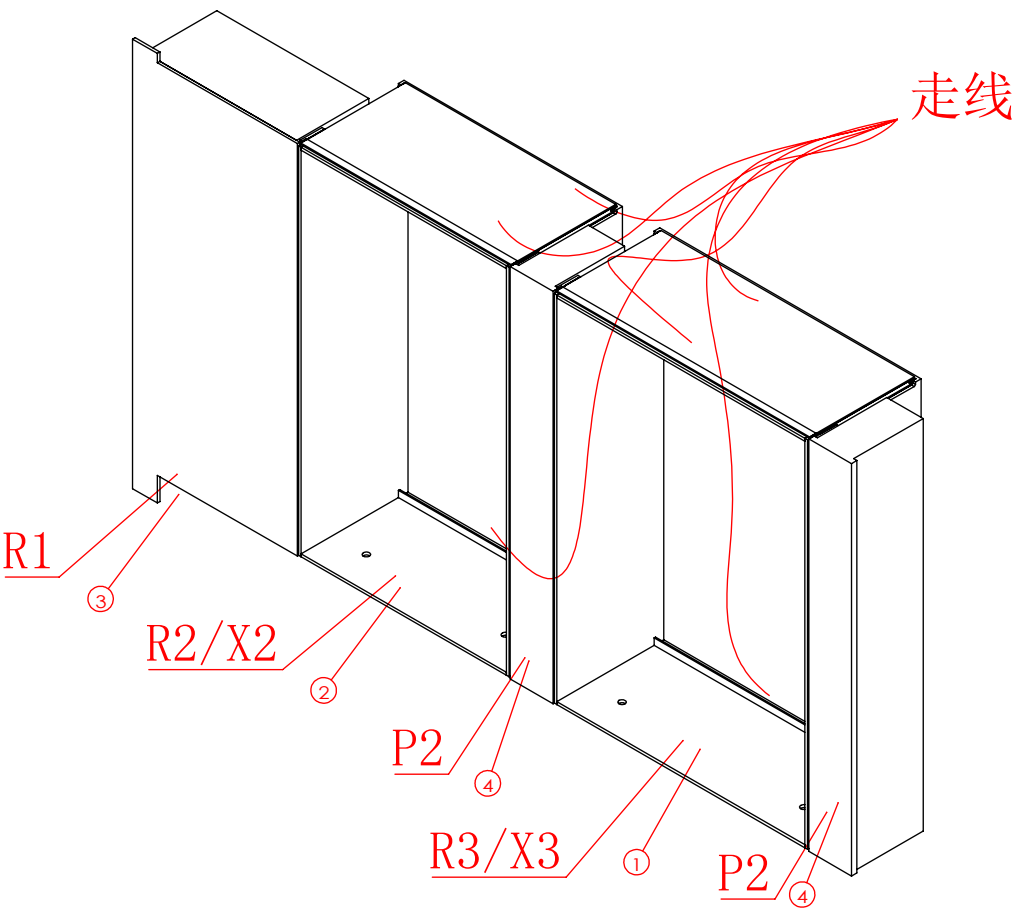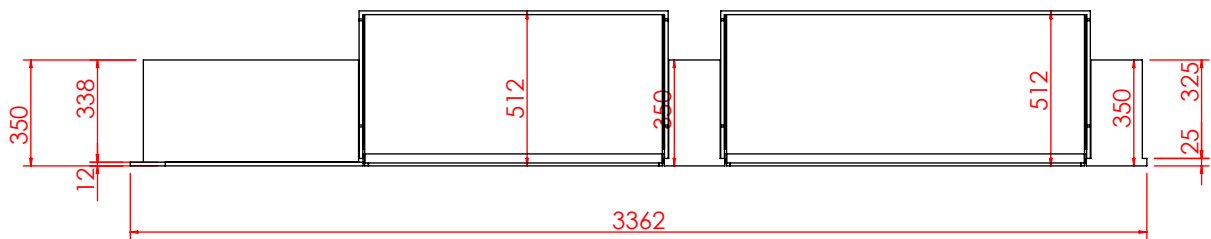

AREA X=R

- 技术要求(Technical Requirements):
- 1、供货方要相应配同色的连接件; 螺杆类连接件要装在相应位置, 以防止孔位偏差;
(The supplier needs to provide the connector and match the color;
The threaded rod must be pre-install into the correct location to avoid the deviation)
 - 2、金属件要求无接棒, 焊接牢固, 无虚焊, 承重部位必须满焊;
(The metal parts must be smoothly, strong welding, full weld on the loading location)
 - 3、金属件所有见光部位不允许有影响外观效果的焊疤;
(Forbid the welding mark on the appearance surface of metal parts)
 - 4、注意公差配合: 镜子和玻璃尺寸, 需与挂臂配合的挂钩内卡口, 如未注明公差按负公差0.5mm加工.
(Take note the tolerance for mirror, glass, the hook which needs to assembled with bar and so on, the unspecified tolerance is -0.5mm.)
 - 5、所有可见螺丝均为内六角螺丝.
(All the appearance screws must be allen screws)
 - 6、所有镜子、玻璃、大理石4边和4角都要磨边, 金属件所有边角无坡锋\无毛刺, 防止伤人。
(All mirrors, glass, marble 4 sides and 4 angles need to sanding, all corners of metal furniture need to polish, no burr, prevent injuries.)
 - 7、凡是涉及到走线的产品, 供货方必须穿好电线。
(The supplier must wear all wire.)
 - 8、供货方必须装配好由供货方生产的配套产品, 例如层板托、连接件。
(the supplier must Pre assembled accessory, such as lamination, connector.)
 - 9 所有部件焊接时要磨45°左右的斜边, 辅助焊接, 超过轮廓线外的焊点要磨平。

SHEET FORMAT 图纸大小	A3	UNITS单位	mm	8Z70127100-X	-总装	PROJECT NO.内部单号	STORE CODE店铺号
DRAWN BY制图	FrazerZhu	SCALE比例	1:25			0000/00	0000
ORDER DATE下单日期	00/00/00	DELIVERY DATE入库日期	00/00/00			ORDER NO.订单号	000
CLIENT DRAWING客户图	Proy V.0	VERSION版本	V.0			ZARA	
ASSEMBLED IN:组装场所	INTERIOR	DRAWING TYPE图纸类型	MANUFACTURING			CAAMAÑOASIA®	