
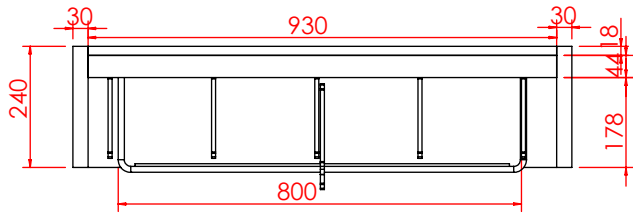
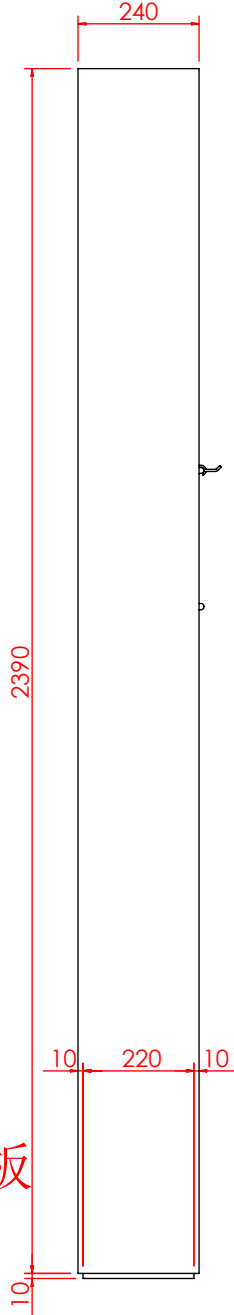
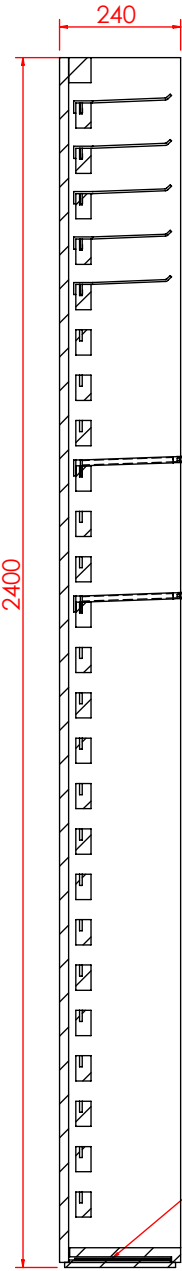


QTY数量	DESCRIBE描述	SUPPLIER供应部门	REFERENCE参考信息	MATERIAL材料	FINISH颜色	PROCESSES工艺	UNIT WEIGHT单件重量 (Kg)	TOTAL WEIGHT总重量 (Kg)
	8Z40196600	SUPPLIER	REFERENCE	Stainless不锈钢/防火MDF	2202号细拉丝/2201号橡木自然色	cut/weld/drill/polish/paint	117104.16	

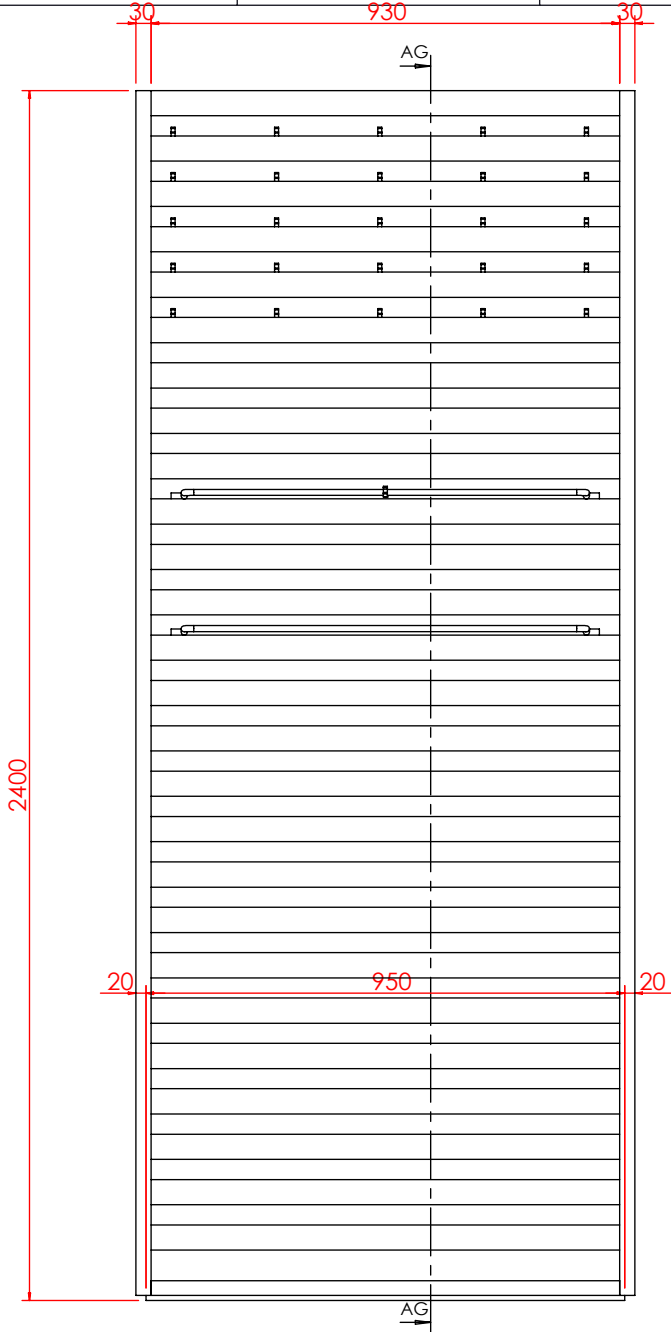

剖面 AG-AG

内部有铁板

此块为活动板
现场与地面固定后
打胶固定

所有挂钩卡槽内都需贴薄毛毡

- 技术要求(Technical Requirements):
- 供货方要相应配同色的连接件; 螺杆类连接件要装在相应位置, 以防止孔位偏差;
(The supplier needs to provide the connector and match the color;
The threaded rod must be pre-install into the correct location to avoid the deviation)
 - 金属件要求无披锋, 焊接牢固, 无虚焊, 承重部位必须满焊;
(The metal parts must be smoothly, strong welding, full weld on the loading location)
 - 金属件所有见光部位不允许有影响外观效果的焊疤;
(Forbid the welding mark on the appearance surface of metal parts)
 - 注意公差配合: 镜子和玻璃尺寸, 需与挂臂配合的挂钩内卡口, 如未注明公差按负公差0.5mm加工.
(Take note the tolerance for mirror, glass, the hook which needs to assembled with bar and so on, the unspecified tolerance is -0.5mm.)
 - 所有可见螺丝均为内六角螺丝.
(All the appearance screws must be allen screws)
 - 所有镜子、玻璃、大理石4边和4角都要磨边, 金属件所有边角无披锋\无毛刺, 防止伤人。
(All mirrors, glass, marble 4 sides and 4 angles need to sanding, all corners of metal furniture need to polish, no burr, prevent injuries.)
 - 凡是涉及到走线的产品, 供货方必须穿好电线。
(The supplier must wear all wire.)
 - 供货方必须装配好由供货方生产的配套产品, 例如层板托、连接件。
(the supplier must Pre assembled accessory, such as lamination, connector.)
 - 所有部件焊接时要磨45°左右的斜边, 辅助焊接, 超过轮廓线外的焊点要磨平。

项目号	零件号	说明	数量	长度	角度1	角度2
1	5Z42196601		1			
2	5Z41173404		1			
3	5Z41173405		1			
4	5Z41173403		2			
5	5Z41173402		25			

SHEET FORMAT 图纸大小	A3	UNITS单位	mm	8Z40196600	-总装	PROJECT NO.内部单号	STORE CODE店铺号
DRAWN BY制图	NikoXu	SCALE比例	1:15			0000/00	0000
ORDER DATE下单日期	00/00/00	DELIVERY DATE入库日期	00/00/00			ORDER NO.订单号	000
CLIENT DRAWING图片图	Proy V.0	VERSION版本	V.0			ZARA	
ASSEMBLED IN:组装场所	INTERIOR	DRAWING TYPE图纸类型	MANUFACTURING			CAAMAÑOASIA®	