




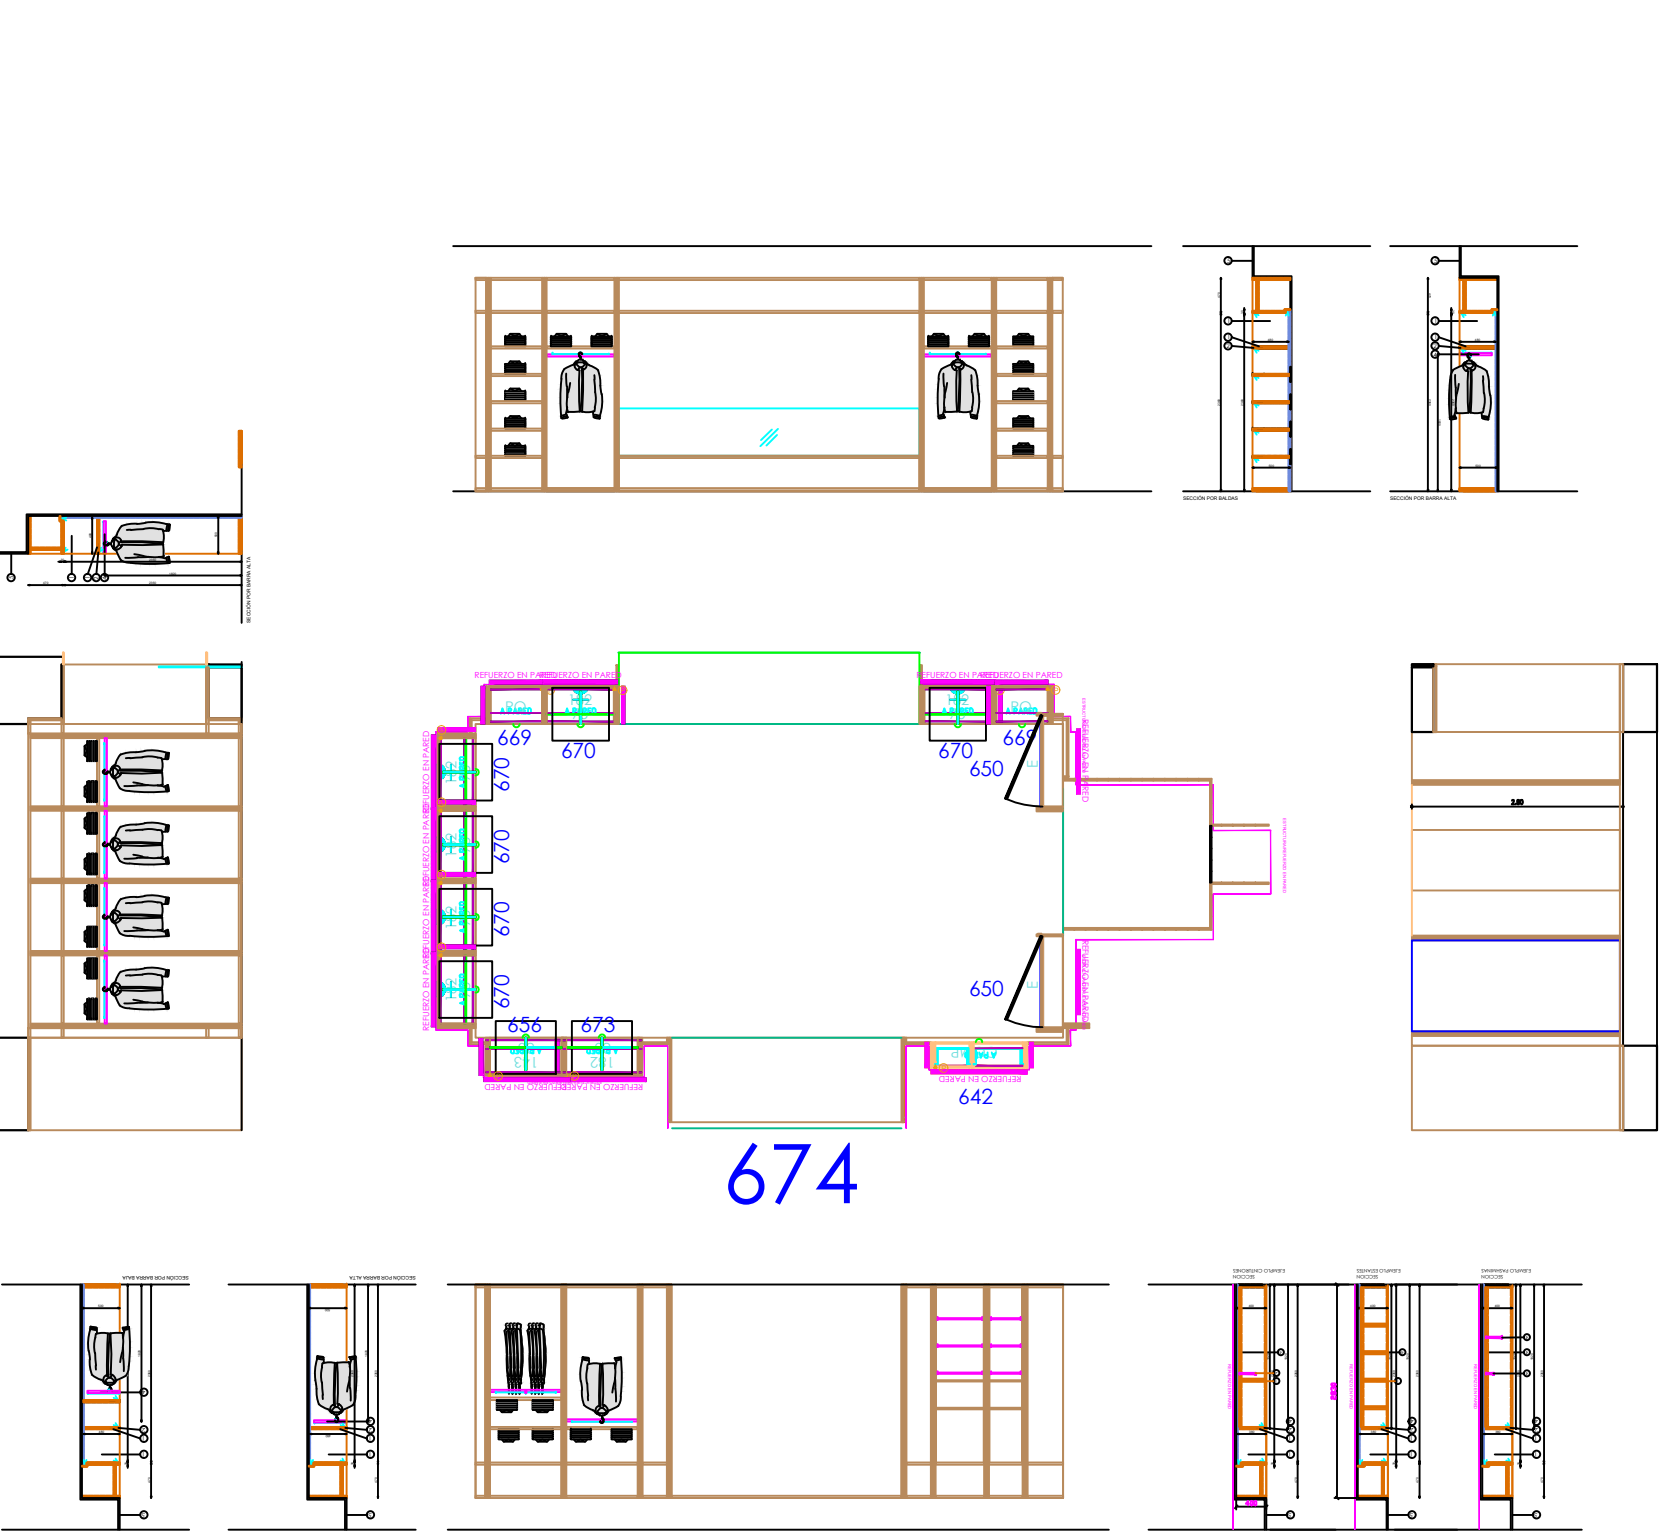

- ACABADOS
- ① MADERA MACIZA QUEMADA INDUSTRIAL REF 2410-V02
  - ② ILUMINACION LED OPALUX 3100°K
  - ③ METAL NEGRO ACABADO MARTILLEADO JORGE EIROA
  - ④ ACERO INOX SATINADO ESTANDAR. REF 2202
  - ⑤ ACABADO PARED

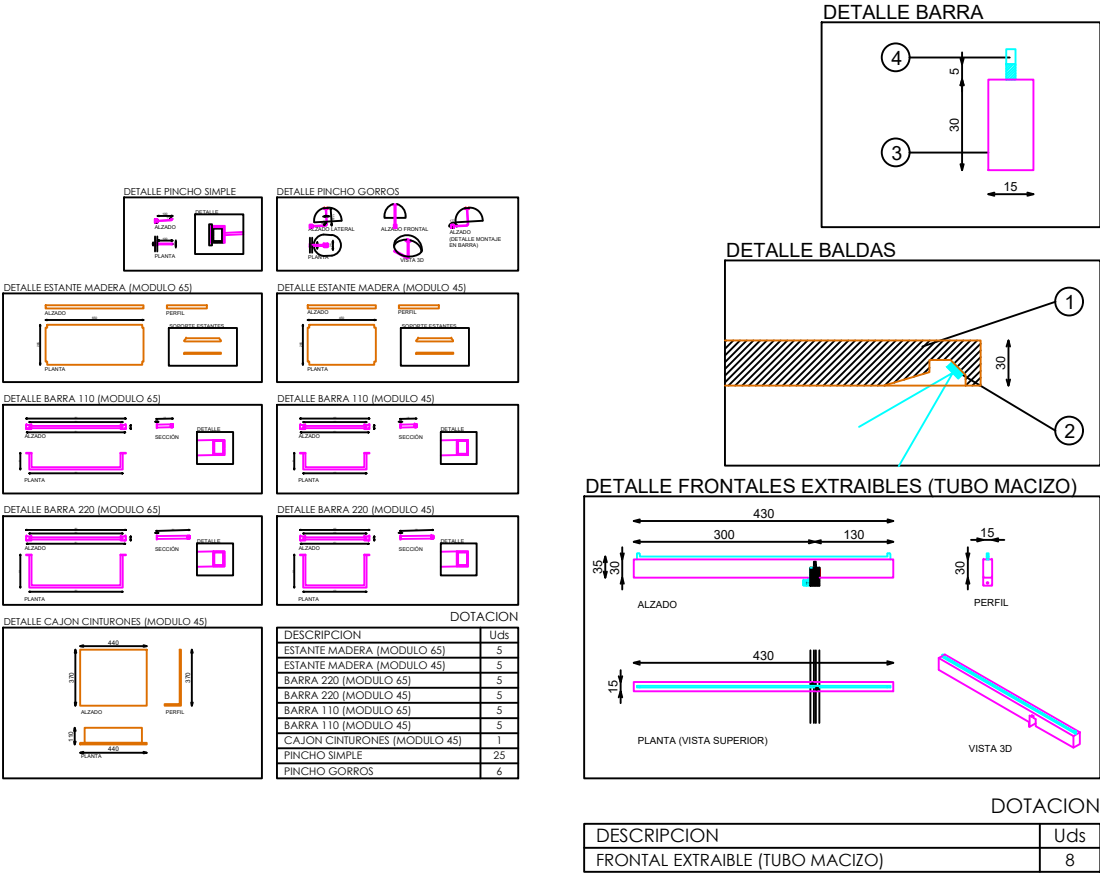

| QTY数量 | DESCRIBE描述 | SUPPLIER供应部门 | REFERENCE参考信息 | MATERIAL材料 | FINISH颜色                                      | PROCESSES工艺                 | UNIT WEIGHT单件重量 (Kg) | TOTAL WEIGHT总重量 (Kg) |
|-------|------------|--------------|---------------|------------|-----------------------------------------------|-----------------------------|----------------------|----------------------|
|       | 8Z70369800 | SUPPLIER     | REFERENCE     | 松木实木       | MADERA MACIZA QUEMADA INDUSTRIAL REF 2410-V02 | cut/weld/drill/polish/paint | 516.51               |                      |

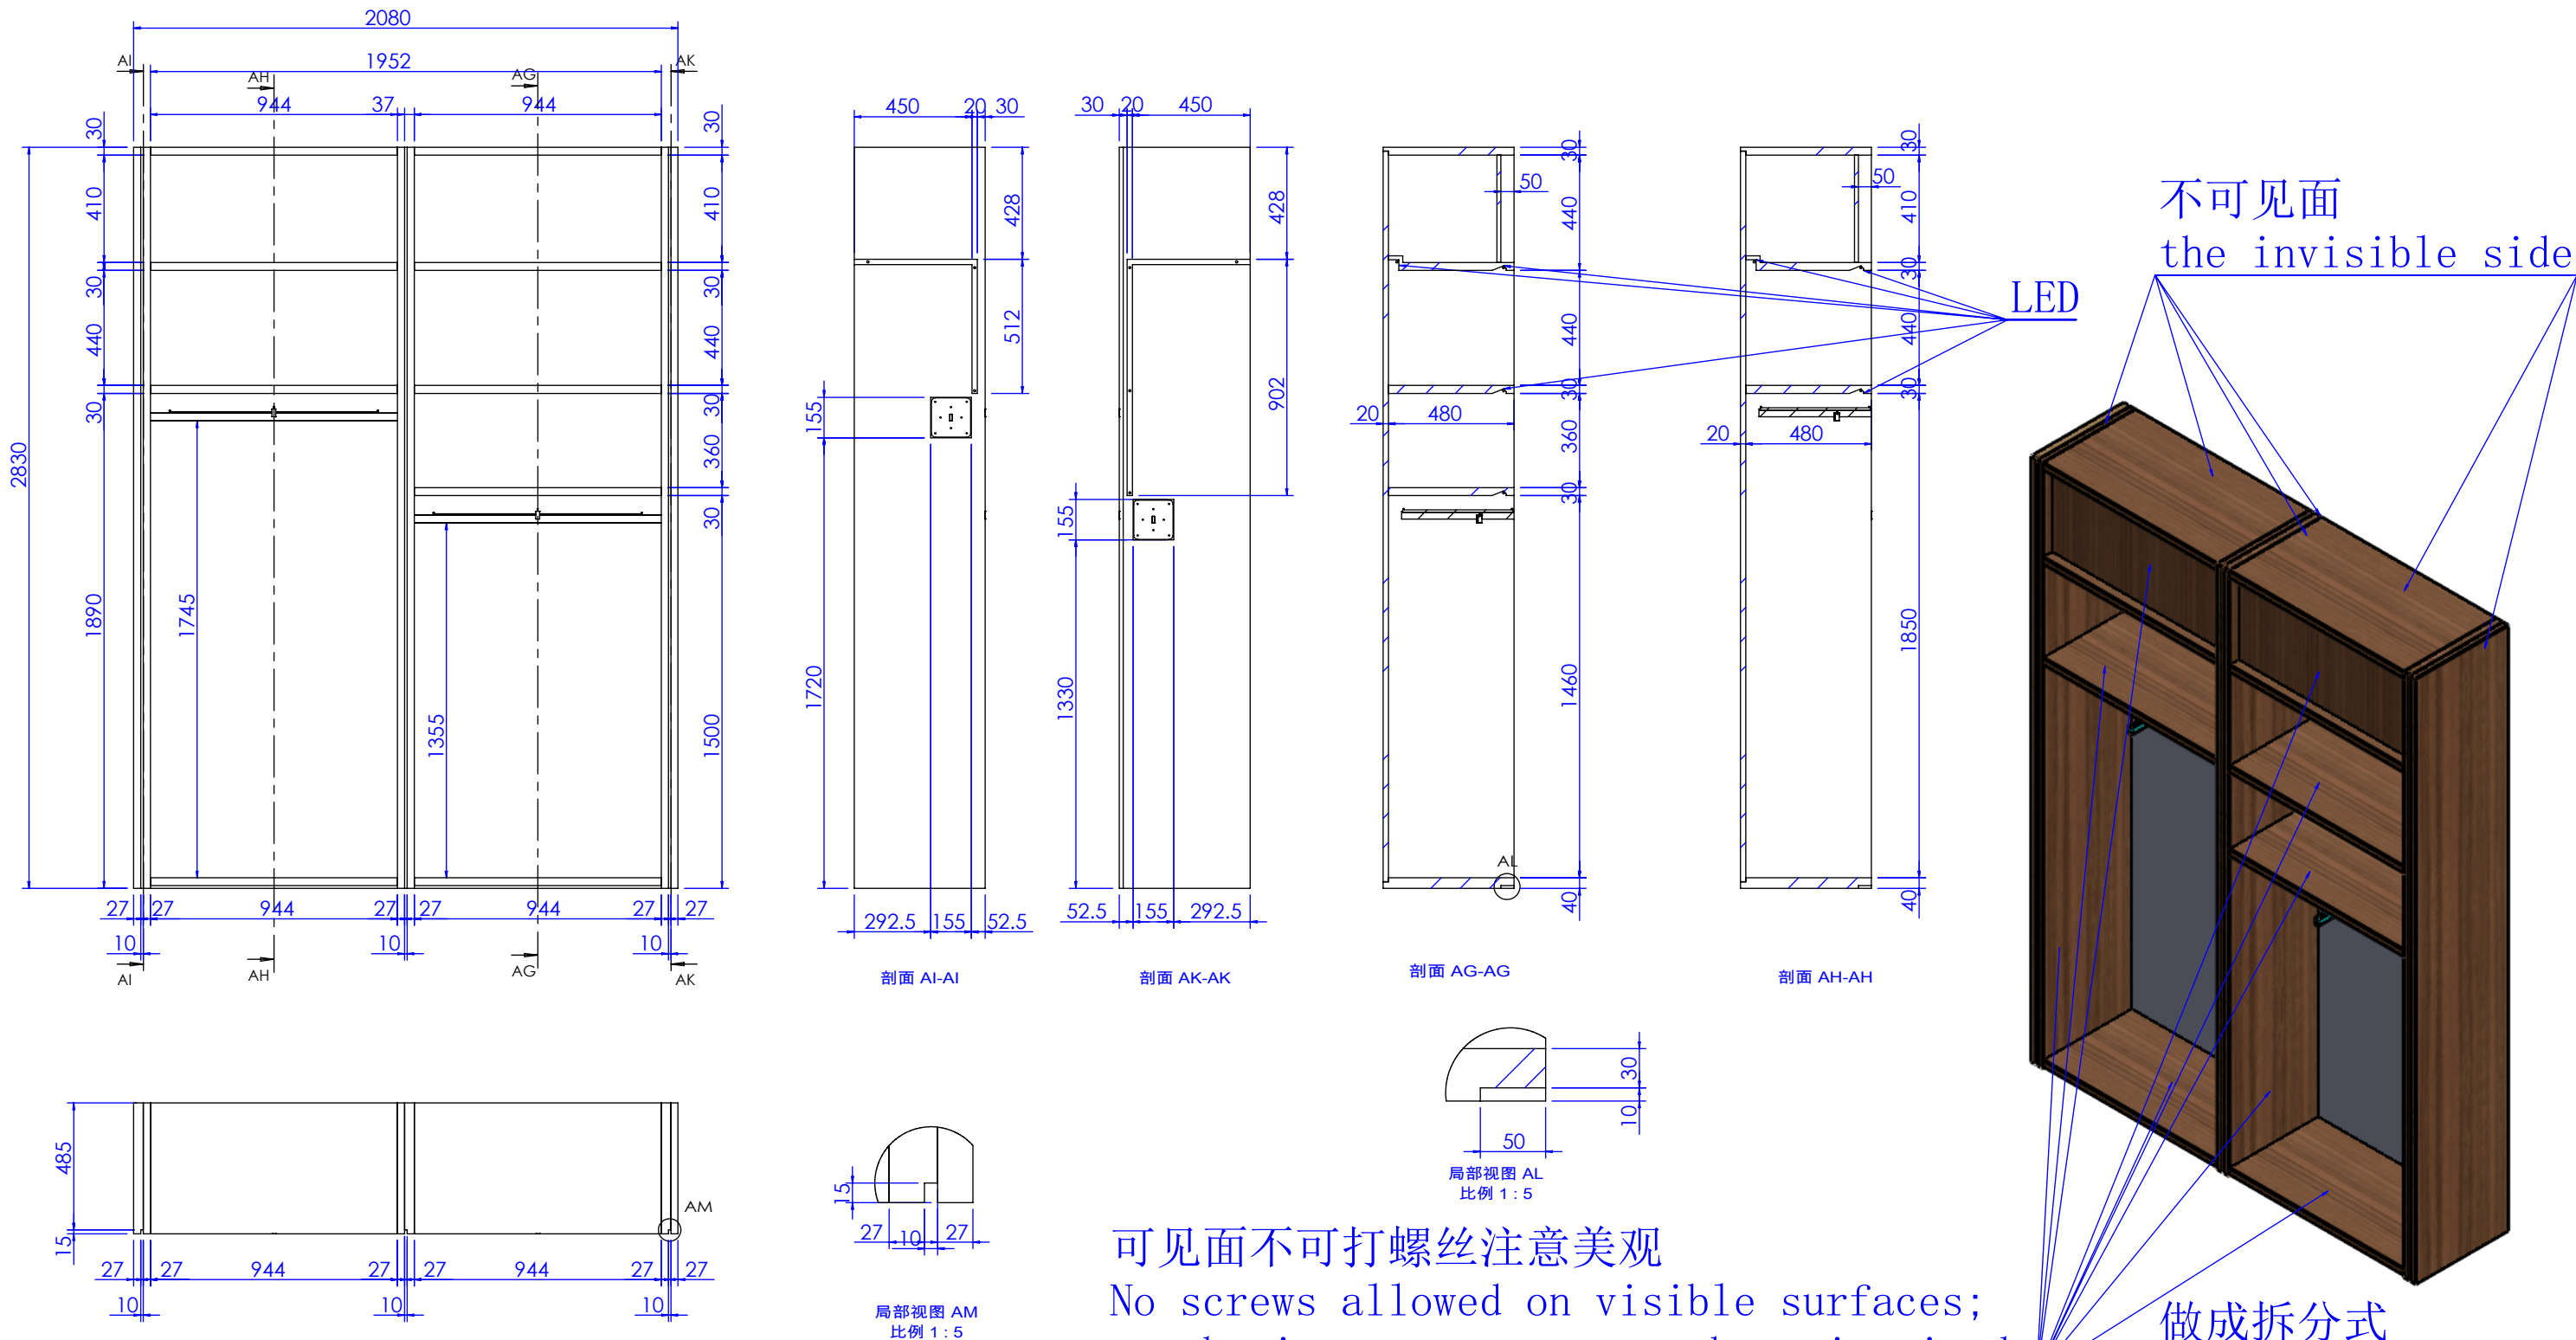

可见面不可打螺丝注意美观  
No screws allowed on visible surfaces;  
aesthetic appearance must be maintained.

做成拆分式  
Make it detachable

- 技术要求(Technical Requirements):
- 1、供货方要相应配同色的连接件; 螺杆类连接件要装在相应位置, 以防止孔位偏差;  
(The supplier needs to provide the connector and match the color;  
The threaded rod must be pre-installed into the correct location to avoid the deviation)
  - 2、金属件要求无接缝, 焊接牢固, 无虚焊, 承重部位必须满焊;  
(The metal parts must be smoothly, strong welding, full weld on the loading location)
  - 3、金属件所有见光部位不允许有影响外观效果的焊疤;  
(Forbid the welding mark on the appearance surface of metal parts)
  - 4、注意公差配合: 镜子和玻璃尺寸, 需与挂臂配合的挂钩内卡口, 如未注明公差按负公差0.5mm加工.  
(Take note the tolerance for mirror, glass, the hook which needs to assembled with bar and so on, the unspecified tolerance is -0.5mm.)
  - 5、所有可见螺丝均为内六角螺丝.  
(All the appearance screws must be allen screws)
  - 6、所有镜子、玻璃、大理石4边和4角都要磨边, 金属件所有边角无坡锋\无毛刺, 防止伤人.  
(All mirrors, glass, marble 4 sides and 4 angles need to sanding, all corners of metal furniture need to polish, no burr, prevent injuries.)
  - 7、凡是涉及到走线的产品, 供货方必须穿好电线.  
(The supplier must wear all wire.)
  - 8、供货方必须装配好由供货方生产的配套产品, 例如层板托、连接件.  
(the supplier must Pre assembled accessory, such as lamination, connector.)
  - 9 所有部件焊接时要磨45°左右的斜边, 辅助焊接, 超过轮廓线外的焊点要磨平。

|                      |          |                   |               |                             |      |                 |               |
|----------------------|----------|-------------------|---------------|-----------------------------|------|-----------------|---------------|
| SHEET FORMAT<br>图纸大小 | A3       | UNITS单位           | mm            | 8Z70369800                  | -ALL | PROJECT NO.内部单号 | STORE CODE店铺号 |
| DRAWN BY制图           | JerryLu  | SCALE比例           | 1:25          |                             |      | 0000/00         | 0000          |
| ORDER DATE下单日期       | 00/00/00 | DELIVERY DATE入库日期 | 00/00/00      |                             |      | ORDER NO.订单号    | 000           |
| CLIENT DRAWING图户图    | Proy V.0 | VERSION版本         | V.0           |                             |      |                 |               |
| ASSEMBLED IN:组装场所    | INTERIOR | DRAWING TYPE图纸类型  | MANUFACTURING |                             |      |                 |               |
|                      |          |                   |               | REFUERZO EN PARED CABINET-3 |      |                 |               |
|                      |          |                   |               |                             |      |                 |               |

