

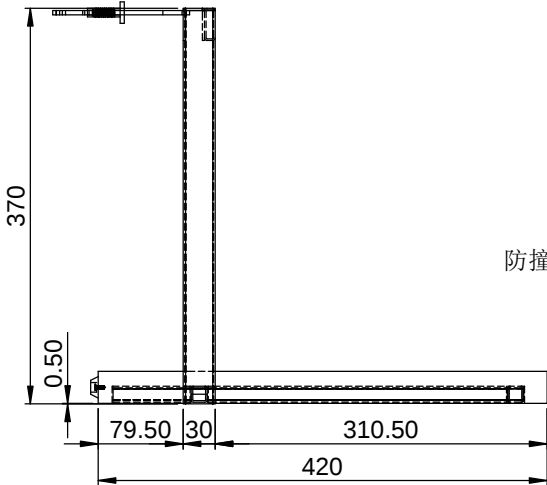





QTY数量	DESCRIBE描述	SUPPLIER供应部门	REFERENCE参考信息	MATERIAL材料	FINISH颜色	PROCESSES工艺	UNIT WEIGHT单件重量(Kg)	TOTAL WEIGHT总重量(Kg)
	8Z30033200	SUPPLIER	8-3-2-27-N-NEP-MA-V01	IRON铁/防火MDF	1701/NCS-S0500N BRILLO 05	cut/weld/drill/polish/paint	3.08	

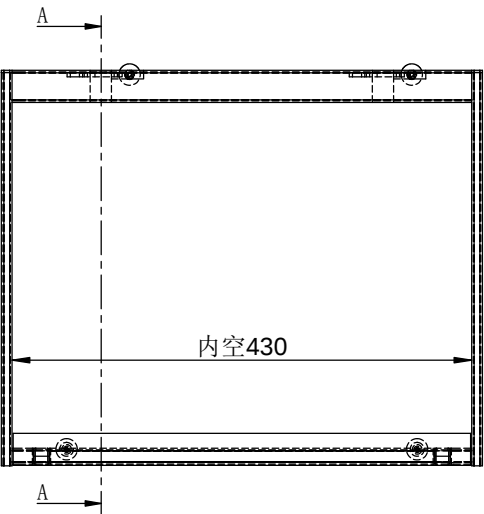

防撞垫

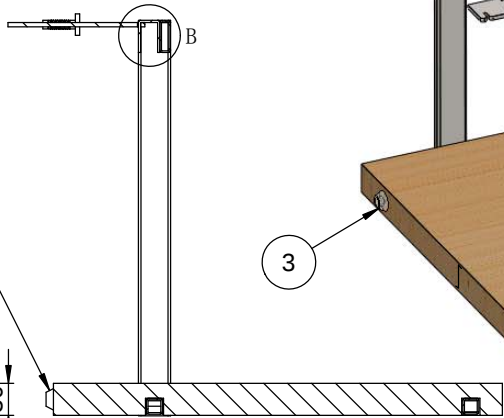

剖面 A-A
比例 1 : 5

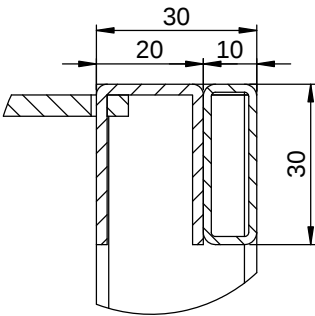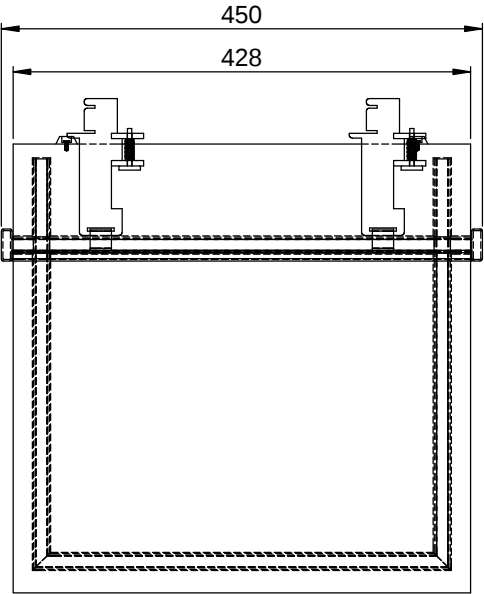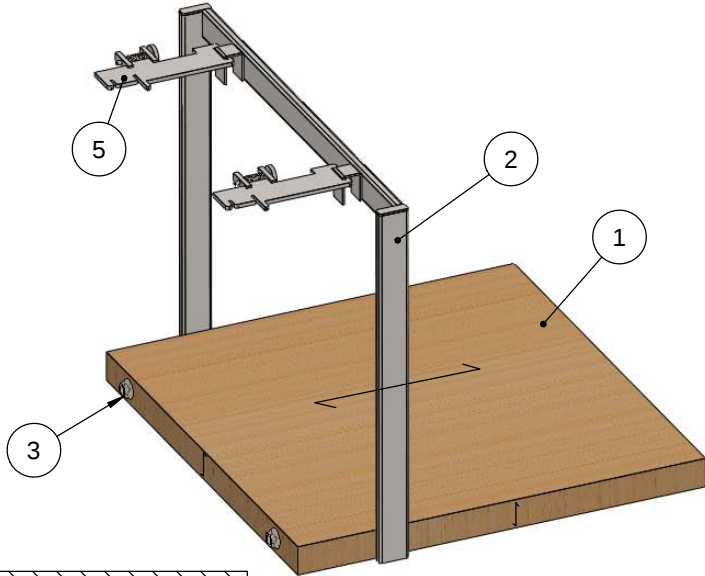

局部视图 B
比例 1 : 1

- 技术要求(Technical Requirements):
- 1、供货方要相应同色的连接件;螺柱类连接件要装在相应位置,以防止孔位偏差;
(The supplier needs to provide the connector and match the color.
(The threaded rod must be pre-installed into the correct location to avoid the deviation)
 - 2、金属件要求无披锋,焊接牢固,无虚焊,承重部位必须满焊;
(The metal parts must be smoothly, strong welding, full weld on the loading location)
 - 3、金属件所有见光部位不允许有影响外观效果的焊疤;
(Forbid the welding mark on the appearance surface of metal parts)
 - 4、注意公差配合镜子和玻璃尺寸,需与挂臂配合的挂钩内卡口,如未注明公差按公差0.5mm加工.
(Take note the tolerance for mirror, glass, the hook which needs to assembled with bar and so on, the unspecified tolerance is -0.5mm.)
 - 5、所有可见螺丝均为内六角螺丝;
(All the appearance screws must be allen screws)
 - 6、所有镜子、玻璃、大理石4边和4角都要磨边,金属件所有边角无毛刺无毛刺,防止伤人.
(All mirrors, glass, marble 4 sides and 4 angles need to sanding, all corners of metal furniture need to polish, no burr, prevent injuries.)
 - 7、凡是涉及到走线的产品,供货方必须穿好电线.
(The supplier must wear all wire.)
 - 8、供货方必须装配好由供货方生产的配套产品,例如层板托、连接件.
(the supplier must Pre assembled accessory, such as lamination, connector.)

项目号	零件号	FINISH	材料	数量
1	5Z32033202	NCS-S0500N BRILLO 05	防火MDF	1
2	5Z31033201	1709	IRON铁	1
3	防撞垫	透明色	软硅胶	2
4	GB_WOOD_SCREWS_T YPE135°3X10-S			2
5	5Z21789004	1709	IRON铁	2

SHEET FORMAT 图纸大小	A3	UNITS单位	mm	8Z30033200	-总装	PROJECT NO.内部单号	STORE CODE店铺号
DRAWN BY制图	NikoXu	SCALE比例	1:10			0000/00	0000
ORDER DATE下单日期	00/00/00	DELIVERY DATE入库日期	00/00/00			ORDER NO.订单号	000
CLIENT DRAWING图号图	Proy V.0	VERSION版本		V.0		ZARA	
ASSEMBLED IN:组装场所	INTERIOR	DRAWING TYPE图纸类型	MANUFACTURING			CAAMAÑOASIA®	